


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 8462	Main Street: ROLLING_HILL_DR	Cross Street: W_SUGAR_CREEK_RD	Location: SE
ADA ID: BA25565FFD05	Ramp Type: ParaDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

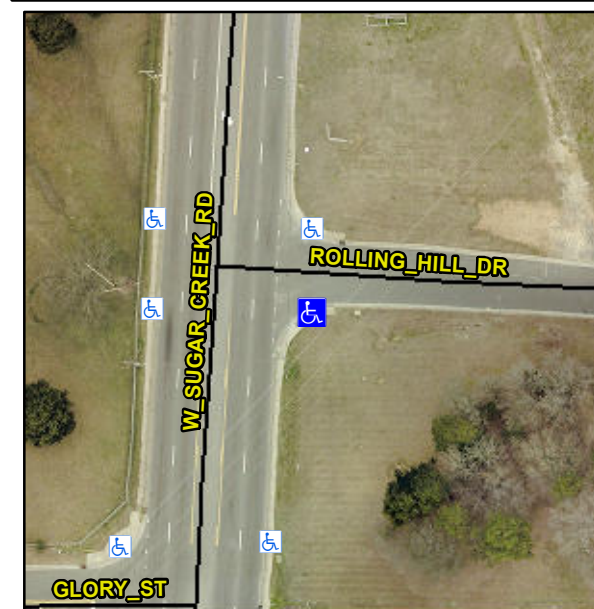

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Gutter Ponding Observed.

Surveyor Notes:

RT RP < 5%

PROW/ADA:

R304.5.3, R302.7

Total Cost: \$ 3700.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	56.0	N/A	Ramp Length RT (in)	60.0
Yes	Ramp Width LT (in)	49.0	Yes	Ramp Width RT (in)	53.0
Yes	Ramp Slope LT (%)	7.7	Yes	Ramp Slope RT (%)	4.3
No	Ramp XSlope LT (%)	2.6	Yes	Ramp XSlope RT (%)	1.1
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.8	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	0.8	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	0.9
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.3
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.8		X Walk 2 Slope (%)	1.0
	X Walk 1 X Slope (%)	0.0		X Walk 2 X Slope (%)	1.7
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.1	N/A	Clear Space?	Yes
	Road X Slope (%)	1.7	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	26.4

