

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10014773	Main Street: E_10TH_ST	Cross Street: N/A	Location: S
ADA ID: BA7132E28FAA	Ramp Type: Combination1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 15	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

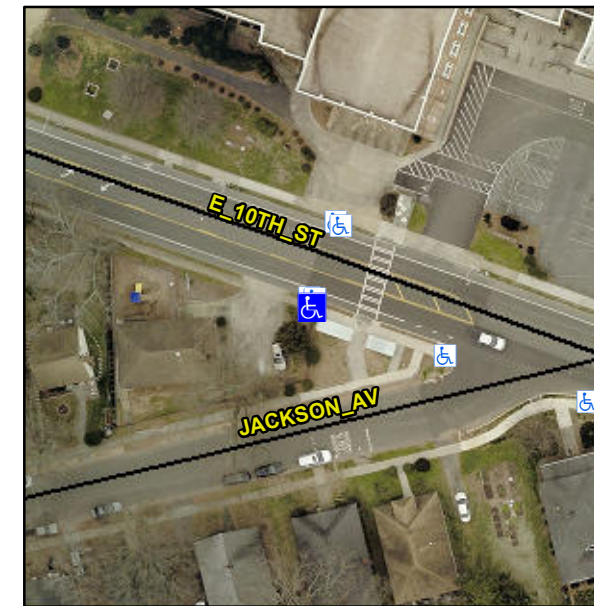

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

RT RP < 5%

PROW/ADA:

**Not Found, R304.2.1, R304.2.2-Perp,
R304.3.2-Para, R304.5.3, R302.7,
R304.5.4**

Street 1 Name	None
Stop Condition-Street 1	E 10TH ST
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 2550.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	61.5	N/A	Ramp Length RT (in)	47.0
Yes	Ramp Width LT (in)	63.0	Yes	Ramp Width RT (in)	64.0
Yes	Ramp Slope LT (%)	5.0	Yes	Ramp Slope RT (%)	4.4
Yes	Ramp XSlope LT (%)	0.4	Yes	Ramp XSlope RT (%)	0.6
N/A	Ramp Length (in)	89.0	Yes	Ramp Slope (%)	0.6
Yes	Ramp Width (in)	72.0	Yes	Ramp XSlope (%)	0.2
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	4.0	Yes	Flare Slope RT (%)	2.1
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	20.5
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.2
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	112.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.6		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.2		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstruction?	No
				Obstruction Type	N/A
			Yes	Storm Grate/Utility Hazard?	No
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	7.4

