


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 42505	Main Street: BULLOCK GREENWAY BV	Cross Street: TOLLESON AV	Location:	N
ADA ID: BA978FEC9EE0	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 12.5
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

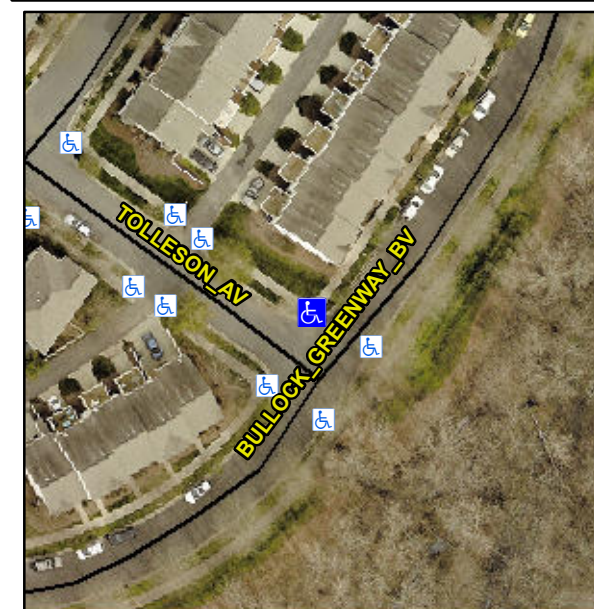

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Gutter Ponding Observed.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2-Perp, R304.3.2-Para, R304.2.3, R305, R302.7

Total Cost: \$ 3700.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	50.5	Yes	Ramp Slope (%)	5.2
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.2
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	4.4	No	Flare Slope RT (%)	11.1
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	70.0	No	DWS Provided?	No
Yes	Landing Width (in)	48.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	5.1	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	1.0	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	4.0
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.0
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.8		X Walk 2 Slope (%)	0.4
	X Walk 1 X Slope (%)	0.3		X Walk 2 X Slope (%)	4.3
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.6	N/A	Clear Space?	Yes
	Road X Slope (%)	0.3	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name TOLLESON AV
 Stop Condition-Street 2 StopSign
 Street 2 Name BULLOCK GREENWAY BV
 Stop Condition-Street 1 None

