


Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 30070 Main Street: SOUTHWIND_DR Cross Street: WATERS_TRAIL_DR Location: NE

ADA ID: BADA8CEC4627 Ramp Type: BlendTrans1 Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 12.5

Codes/Mitigation Info/Possible Solution **Field Measurements/Component Compliance**

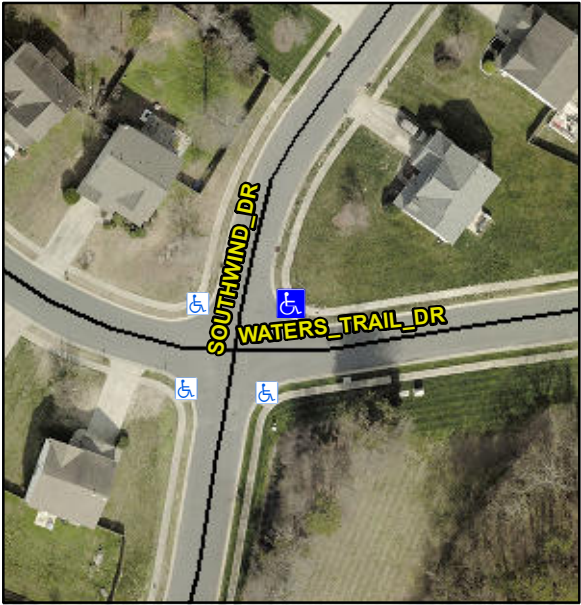

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:
N/A

PROW/ADA:
Not Found, R304.5.3

Street 1 Name **SOUTHWIND DR**
Stop Condition-Street 1 **None**
Street 2 Name **WATERS TRAIL DR**
Stop Condition-Street 2 **StopSign**

Total Cost: \$ **3200.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	49.5	Yes	BlendTrans Slope (%)	4.8
Yes	Ramp Width (in)	48.5	No	BlendTrans XSlope (%)	5.5
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To W		X Walk 2 Direction	To S
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.2		X Walk 2 Slope (%)	0.2
	X Walk 1 X Slope (%)	1.4		X Walk 2 X Slope (%)	3.3
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.5		Clear Space?	N/A
	Road X Slope (%)	0.6	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
Yes	Surface Condition? (G/P)		Yes		Good
No	Curb Slope (%)		No		7.0

