

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10020649	Main Street: BAYSE_CT	Cross Street: N/A	Location: NE
ADA ID: BB111A3BA31F	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 20.25

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

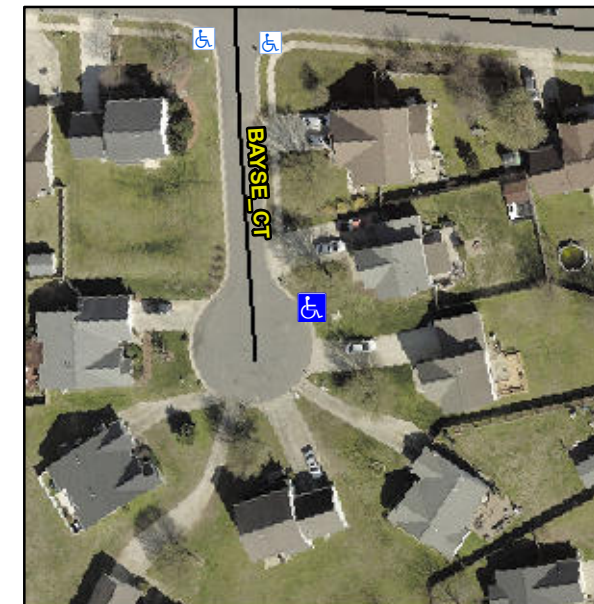

Possible Solutions:

**Remove & Replace Entire Ramp.  
Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.3, R304.2.1, R304.2.2-Perp,  
R304.3.2-Para, R304.2.3, R305,  
R304.5.4**

Total Cost: \$ 2600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	50.0	Yes	Ramp Slope (%)	6.4
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.1
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	13.6	N/A	Flare Slope RT (%)	9.0
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No
No	Landing Length (in)	47.0	No	DWS Provided?	No
Yes	Landing Width (in)	48.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	3.2	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	1.3	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	9.3
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.4
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.8		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name	BAYSE CT
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

