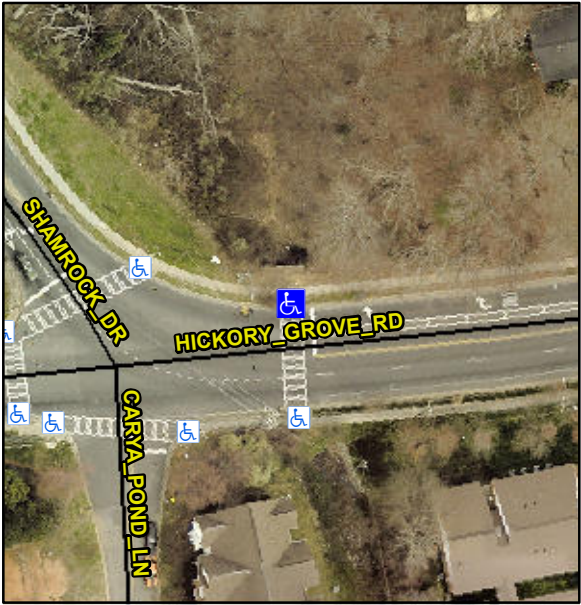


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 12830	Main Street: CARYA_POND_LN	Cross Street: HICKORY_GROVE_RD	Location: NE
ADA ID: BB549A2294E0	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Entire Ramp.</b>		<b>Yes</b>	Ramp Length (in)	50.0
			<b>Yes</b>	Ramp Width (in)	49.0
			<b>N/A</b>	Flare Type LT	Sloped
			<b>N/A</b>	Flare Slope LT (%)	5.2
			<b>N/A</b>	Flare Traversable LT?	Yes
			<b>Yes</b>	Landing Length (in)	57.0
			<b>Yes</b>	Landing Width (in)	49.0
			<b>Yes</b>	Landing Slope (%)	1.3
			<b>Yes</b>	Landing X Slope (%)	0.7
<p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>Not Found</b></p>			<b>N/A</b>	Flare Type RT	N/A
			<b>Yes</b>	Flare Slope RT (%)	5.4
			<b>N/A</b>	Flare Traversable RT?	Yes
			<b>Yes</b>	DWS Provided?	Yes
			<b>Yes</b>	DWS Contrast?	Yes
			<b>Yes</b>	DWS Length (in)	24.0
			<b>Yes</b>	DWS Full Width?	Yes
			<b>Yes</b>	DWS Offset (in)	0.5
			<b>No</b>	Shared Landing?	No
			<b>No</b>	Gutter Ponding?	No
			<b>Yes</b>	Gutter Lip Ht (in)	0.0
			<b>N/A</b>	Painted X Walk1?	Yes
				X Walk 1 Direction	To S
			<b>N/A</b>	X Walk 1 Width (in)	120.0
				X Walk 1 Slope (%)	2.2
				X Walk 1 X Slope (%)	0.6
			<b>Yes</b>	Ramp inside XWalk1?	Yes
			<b>N/A</b>	Road Slope (%)	N/A
			<b>N/A</b>	Road X Slope (%)	N/A
			<b>Yes</b>	Any Obstructions?	No
				Obstruction Type	
			<b>N/A</b>		
			<b>Yes</b>	Surface Condition? (G/P)	Good
Total Cost:		\$ 1850.00			

Street 1 Name	HICKORY GROVE RD
Stop Condition-Street 2	Signal
Street 2 Name	N/A
Stop Condition-Street 1	N/A

