


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 52453	Main Street: PAT_GARRETT_ST	Cross Street: DOUBLE_OAKS_RD	Location: SE
ADA ID: BBADA46923DC	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 20.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

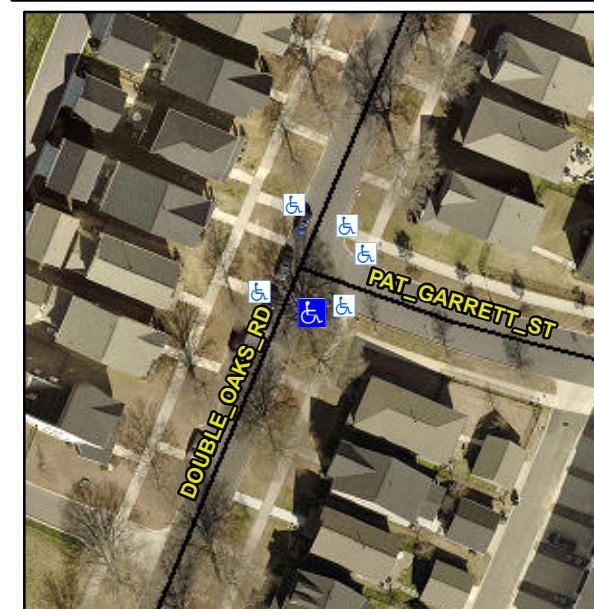

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R302.7.2, R304.5.4

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	80.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	66.0	No	Grade Break Slope (%)	6.0
Yes	Ramp Slope (%)	6.2	No	Grade Break XSlope (%)	2.8
No	Ramp XSlope (%)	3.2			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	72.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	72.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.5	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	3.6	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	1.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	16.0
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.5
No	Gutter Lip Ht (in)	1.0	No	Gutter X Slope (%)	3.5
N/A	Painted X Walk1?	No		Road Slope (%)	2.9
	X Walk 1 Direction	To W		Road X Slope (%)	1.9
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	2.9	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	1.9	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	1.9

Total Cost: \$ 2350.00

