

## Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 19048 Main Street: CORY-BRET\_LN Cross Street: SHOPTON\_RD\_WEST Location: NE

ADA ID: BBB0754C5E1B Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

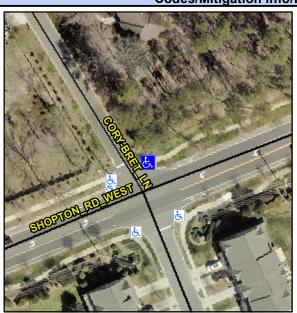

Street 1 Name
Stop Condition-Street 2
Street 2 Name
Stop Condition-Street 1

CORY-BRET LN
StopSign
SHOPTON RD WEST
None

Possible Solutions:

Remove & Replace Curb Ramp With
Two New Directional Ramps or
Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2, R304.5.3

Total Cost: \$ 3200.00

Compliance Description Data Compliance Description Data No N/A Ramp Length (in) 56.0 Ramp Slope (%) 8.9 No Ramp XSlope (%) Yes Ramp Width (in) 48.0 4.6 N/A N/A Flare Type LT N/A Flare Type RT N/A N/A N/A N/A Flare Slope RT (%) N/A Flare Slope LT (%) N/A Flare Traversable LT? N/A N/A Flare Traversable RT? N/A N/A N/A N/A **DWS Provided?** N/A Landing Length (in) N/A Landing Width (in) N/A N/A **DWS Contrast?** N/A N/A N/A N/A Landing Slope (%) DWS Length (in) N/A N/A Landing X Slope (%) N/A N/A DWS Full Width? N/A N/A Landing Curb? (Y/N) N/A N/A DWS Offset (in) N/A N/A N/A Shared Landing? N/A Gutter Ponding? N/A N/A Gutter Slope (%) N/A N/A Gutter Lip Ht (in) 0.5 N/A Gutter X Slope (%) N/A N/A Painted X Walk1? No N/A Painted X Walk2? No X Walk 1 Direction To SW X Walk 2 Direction To SE N/A N/A N/A X Walk 1 Width (in) X Walk 2 Width (in) N/A X Walk 1 Slope (%) 1.2 X Walk 2 Slope (%) 6.7 X Walk 1 X Slope (%) 7.8 X Walk 2 X Slope (%) 0.1 N/A N/A N/A Ramp inside XWalk2? N/A Ramp inside XWalk1? Road Slope (%) 2.9 N/A Clear Space? N/A N/A Road X Slope (%) 5.0 Clear Space to XWalk (in) N/A N/A N/A N/A Any Obstructions? Storm Grate/Utility Hazard? N/A **Obstruction Type** Storm Grate/Utility Type N/A N/A Yes Surface Condition? (G/P) Good





