

## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Data

65.5

48.0

9.8

4.4

5.7

2.3

N/A

Intersection ID: 53704 Main Street: MILLSTREAM RIDGE DR Cross Street: MILLSTREAM RIDGE DR Location: Ε **Severity Score:** 22.5 ADA ID: BBEE3A6822E7 Ramp Type: Combination1 Initial Pass/Fail: Fail **Overall Compliance: No** 

**Codes/Mitigation Info/Possible Solution** 

## Field Measurements/Component Compliance

N/A

Yes

No

No

Yes

No

N/A

Compliance Description

Ramp Length RT (in)

Ramp Width RT (in)

Ramp Slope RT (%)

Ramp XSlope RT (%)

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

**DWS Contrast?** 

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)

Flare Traversable RT?

Data

54.0

48.0

4.0

2.4

49.0

40.5

N/A

Yes

74.0

To NW

Ramp Length LT (in)

Ramp Width LT (in)

Ramp Slope LT (%)

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Landing Length (in)

Landing Width (in)

Landing Slope (%)

Landing X Slope (%)

Landing Curb? (Y/N)

Shared Landing?

**Gutter Ponding?** 

Gutter Lip Ht (in)

Painted X Walk1?


X Walk 1 Direction

X Walk 1 Width (in)

Flare Traversable LT?

Flare Type LT

Ramp XSlope LT (%)

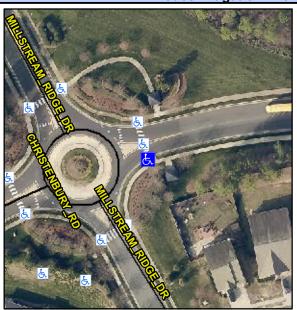

YieldSign Street 1 Name **CHRISTENBURY RD** Stop Condition-Street 1 N/A Street 2 Name Stop Condition-Street 2 N/A Possible Solutions: Compliance Description N/A Remove & Replace Entire Ramp. Yes Yes No N/A No Surveyor Notes: N/A **CURB GAP 1.5, LT RP < 5%** N/A N/A N/A N/A PROW/ADA: N/A R304.5.1, R304.5.3, R304.3.2 N/A N/A N/A N/A N/A N/A



Total Cost:



		/			/ · · · · · · · · · · · · · · · · · · ·		
		X Walk 1 Slope (%)	4.9		X Walk 2 Slope (%)	N/A	
		X Walk 1 X Slope (%)	2.1		X Walk 2 X Slope (%)	N/A	
1800.00	N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A	
		Road Slope (%)	N/A		Clear Space?	N/A	
		Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
				N/A	Any Obstruction?	N/A	
					Obstruction Type		
						N/A	
-			N/A	Storm Grate/Utility Hazard?	N/A		
				Storm Grate/Utility Type			
						N/A	
1				Yes	Surface Condition? (G/P)	Good	
					Curb Slope (%)	N/A	