

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 27788	Main Street: PROVIDENCE_RD	Cross Street: PROVIDENCE_COUNTRY_CLUB_DR	Location: NW
ADA ID: BBF2F6BB5E27	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0.25	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

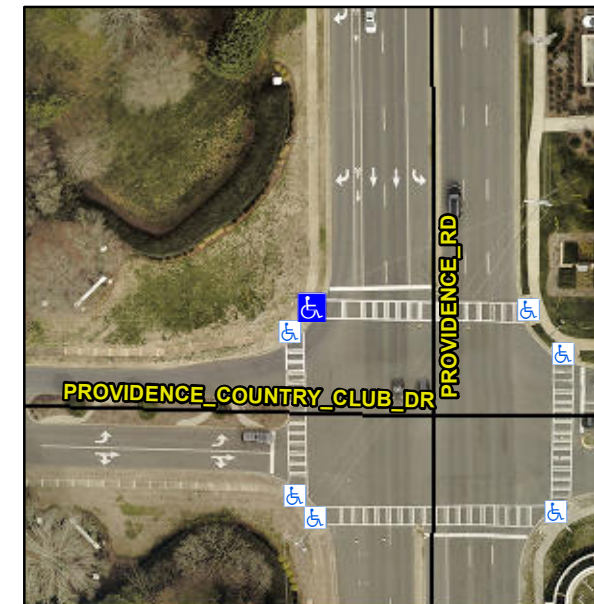

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R304.2.2-Perp, R304.3.2-Para, R305.2

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	49.0	Yes	BlendTrans Slope (%)	4.2
Yes	Ramp Width (in)	58.0	No	BlendTrans XSlope (%)	4.3
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
Yes	Flare Slope LT (%)	1.5	N/A	Flare Slope RT (%)	10.6
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	59.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	54.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.0	Yes	DWS Length (in)	25.0
No	Landing X Slope (%)	5.1	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.1
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	4.0
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To E		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	105.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.1		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.5		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.5		Clear Space?	Yes
	Road X Slope (%)	2.1	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	4.3

Street 1 Name	PROVIDENCE RD
Stop Condition-Street 1	Signal
Street 2 Name	N/A
Stop Condition-Street 2	N/A

