

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

|                        |                             |                              |                        |
|------------------------|-----------------------------|------------------------------|------------------------|
| Intersection ID: 24051 | Main Street: DEHAVILLAND_DR | Cross Street: SILVER_DART_PL | Location: SW           |
| ADA ID: BC16DEB70B2D   | Ramp Type: PerpDiag         | Initial Pass/Fail: Fail      | Overall Compliance: No |
|                        |                             | Severity Score: 12.5         |                        |

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

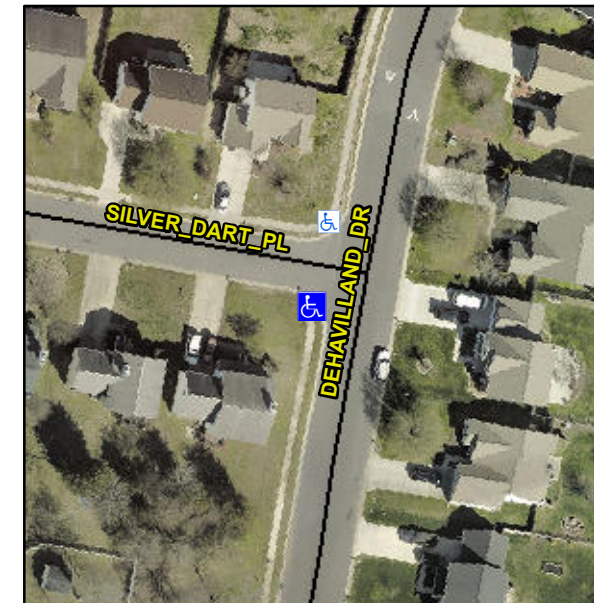

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.3**

Total Cost: \$ 3200.00

| Compliance | Description           | Data  | Compliance | Description                 | Data  |
|------------|-----------------------|-------|------------|-----------------------------|-------|
| N/A        | Ramp Length (in)      | 96.0  | Yes        | Ramp Slope (%)              | 6.0   |
| Yes        | Ramp Width (in)       | 53.0  | No         | Ramp XSlope (%)             | 5.9   |
| N/A        | Flare Type LT         | N/A   | N/A        | Flare Type RT               | N/A   |
| N/A        | Flare Slope LT (%)    | N/A   | N/A        | Flare Slope RT (%)          | N/A   |
| N/A        | Flare Traversable LT? | N/A   | N/A        | Flare Traversable RT?       | N/A   |
| N/A        | Landing Length (in)   | N/A   | N/A        | DWS Provided?               | N/A   |
| N/A        | Landing Width (in)    | N/A   | N/A        | DWS Contrast?               | N/A   |
| N/A        | Landing Slope (%)     | N/A   | N/A        | DWS Length (in)             | N/A   |
| N/A        | Landing X Slope (%)   | N/A   | N/A        | DWS Full Width?             | N/A   |
| N/A        | Landing Curb? (Y/N)   | N/A   | N/A        | DWS Offset (in)             | N/A   |
| N/A        | Shared Landing?       | N/A   |            |                             |       |
| N/A        | Gutter Ponding?       | N/A   | N/A        | Gutter Slope (%)            | N/A   |
| N/A        | Gutter Lip Ht (in)    | N/A   | N/A        | Gutter X Slope (%)          | N/A   |
| N/A        | Painted X Walk1?      | No    | N/A        | Painted X Walk2?            | No    |
|            | X Walk 1 Direction    | To SE |            | X Walk 2 Direction          | To NE |
| N/A        | X Walk 1 Width (in)   | N/A   | N/A        | X Walk 2 Width (in)         | N/A   |
|            | X Walk 1 Slope (%)    | 2.5   |            | X Walk 2 Slope (%)          | 0.3   |
|            | X Walk 1 X Slope (%)  | 0.9   |            | X Walk 2 X Slope (%)        | 5.6   |
| N/A        | Ramp inside XWalk1?   | N/A   | N/A        | Ramp inside XWalk2?         | N/A   |
|            | Road Slope (%)        | 3.0   | N/A        | Clear Space?                | N/A   |
|            | Road X Slope (%)      | 2.4   | N/A        | Clear Space to XWalk (in)   | N/A   |
| N/A        | Any Obstructions?     | N/A   | N/A        | Storm Grate/Utility Hazard? | N/A   |
|            | Obstruction Type      |       |            | Storm Grate/Utility Type    |       |
|            |                       | N/A   |            |                             | N/A   |
|            |                       | Yes   |            | Surface Condition? (G/P)    | Good  |

Street 1 Name SILVER DART PL

Stop Condition-Street 2 None

Street 2 Name DEHAVILLAND DR

Stop Condition-Street 1 StopSign

