


# Access Compliance Report

## Public Rights-of-Way (Curb Ramps)

Intersection ID: N/A	Main Street: ARROWOOD_RD	Cross Street: MICROSOFT_WY	Location: SE
ADA ID: BC21ADC5AA2A	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution			Severity Score: 30
			Field Measurements/Component Compliance

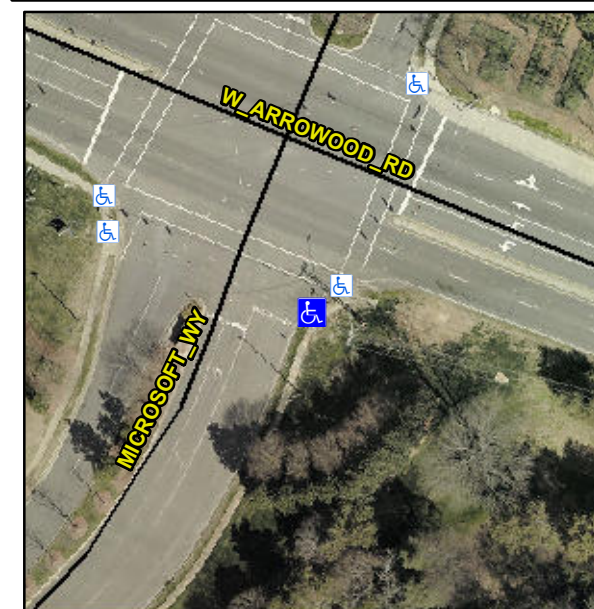

Possible Solutions:

**Remove & Replace Entire Ramp.  
Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.2.1, R304.2.2-Perp, R304.3.2-  
Para, R305, R302.7, R302.7.2,  
R304.5.4**

Total Cost: \$ 2600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	54.0	Yes	Ramp Slope (%)	8.0
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	6.1	Yes	Flare Slope RT (%)	4.2
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	40.0	No	DWS Provided?	No
Yes	Landing Width (in)	48.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	3.3	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	0.7	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	5.2
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	0.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.3		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
		Yes	Yes	Surface Condition? (G/P)	Good

