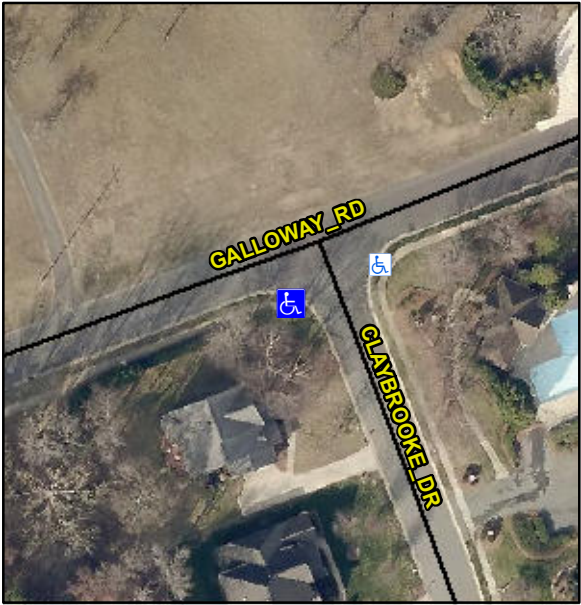


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 4026	Main Street: CLAYBROOKE_DR	Cross Street: GALLOWAY_RD	Location: SW
ADA ID: BC24A13C2C29	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 22.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	Compliance
	Remove & Replace Entire Ramp.		No	Ramp Length (in)	97.0	No
			No	Ramp Width (in)	47.5	No
			N/A	Flare Type LT	N/A	N/A
			N/A	Flare Slope LT (%)	N/A	N/A
			N/A	Flare Traversable LT?	N/A	N/A
			N/A	Landing Length (in)	N/A	N/A
			N/A	Landing Width (in)	N/A	N/A
			N/A	Landing Slope (%)	N/A	N/A
			N/A	Landing X Slope (%)	N/A	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A
			N/A	Shared Landing?	N/A	
			N/A	Gutter Ponding?	N/A	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A
			No	Painted X Walk1?	No	N/A
				X Walk 1 Direction	To E	N/A
			N/A	X Walk 1 Width (in)	N/A	N/A
				X Walk 1 Slope (%)	2.8	N/A
				X Walk 1 X Slope (%)	6.1	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A
Surveyor Notes: N/A PROW/ADA: R304.5.1, R304.2.2, R304.5.3			N/A	Road Slope (%)	N/A	N/A
			N/A	Road X Slope (%)	N/A	N/A
			N/A	Any Obstructions?	N/A	N/A
				Obstruction Type		
			N/A			N/A
			Yes	Surface Condition? (G/P)	Good	
Total Cost:		\$ 1850.00				

Street 1 Name	CLAYBROOKE DR
Stop Condition-Street 2	StopSign
Street 2 Name	N/A
Stop Condition-Street 1	N/A

