

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 11698	Main Street: S CEDAR ST	Cross Street: W 4TH ST	Location: N
ADA ID: BC2805292CC6	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 0

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

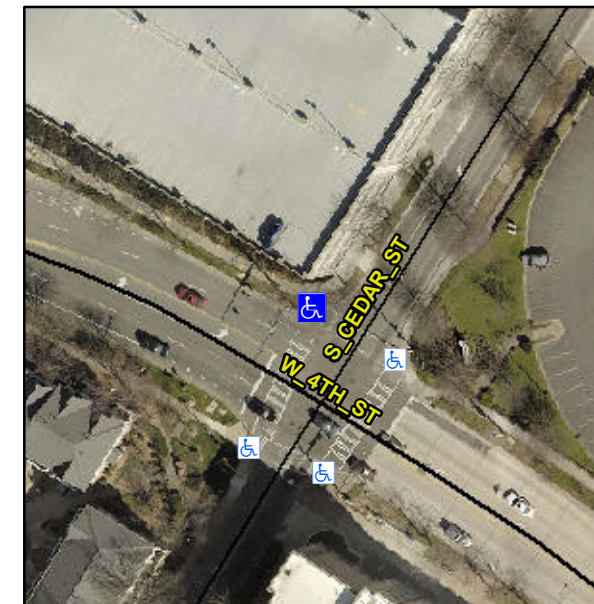

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para, R305.2**

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	84.0	Yes	Ramp Slope (%)	5.6
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	2.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	3.1	Yes	Flare Slope RT (%)	9.4
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	72.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.7	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	Yes	No	DWS Offset (in)	4.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.1
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.1
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To SE		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	100.0	N/A	X Walk 2 Width (in)	110.0
	X Walk 1 Slope (%)	2.2		X Walk 2 Slope (%)	5.1
	X Walk 1 X Slope (%)	1.8		X Walk 2 X Slope (%)	0.0
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	1.8	N/A	Clear Space?	Yes
	Road X Slope (%)	1.2	Yes	Clear Space to XWalk (in)	92.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name S CEDAR ST  
 Stop Condition-Street 2 Signal  
 Street 2 Name W 4TH ST  
 Stop Condition-Street 1 Signal

