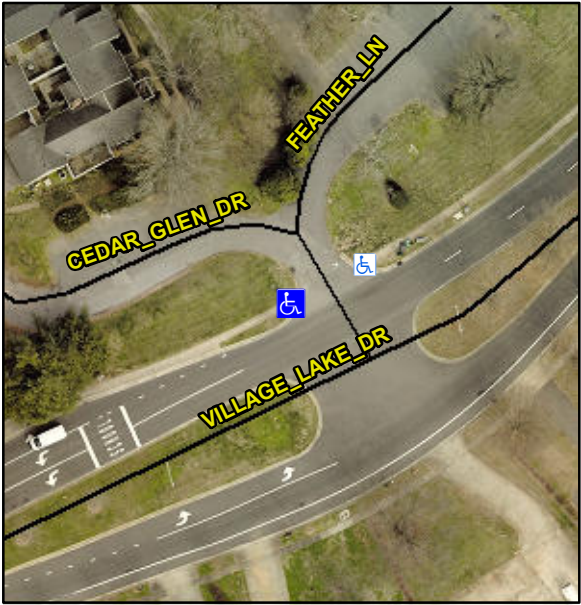


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 19602	Main Street: VILLAGE_LAKE_DR	Cross Street: CEDAR_GLEN_DR	Location: W
ADA ID: BC7F947AF8FA	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
		Possible Solutions:	Compliance	Description	Data
		Remove & Replace Entire Ramp.	N/A	Ramp Length (in)	122.0
<p>Surveyor Notes:</p> <p>N/A</p>			No	Ramp Width (in)	47.5
			Yes	Ramp Slope (%)	7.1
<p>PROW/ADA:</p> <p>R304.5.1, R304.5.3</p>			No	Ramp XSlope (%)	5.8
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	0.0
			N/A	Landing Width (in)	0.0
			N/A	Landing Slope (%)	0.0
			N/A	Landing X Slope (%)	0.0
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	0.0
			N/A	Gutter Lip Ht (in)	0.0
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To NE
				X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	2.7
				X Walk 1 X Slope (%)	0.3
			N/A	Ramp inside XWalk1?	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	24.2
<p>Total Cost: \$ 1600.00</p>					

