

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 13745	Main Street: HAWTHORNE_LN	Cross Street: PARK_DR	Location:	E
ADA ID: BD9A70B2B187	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

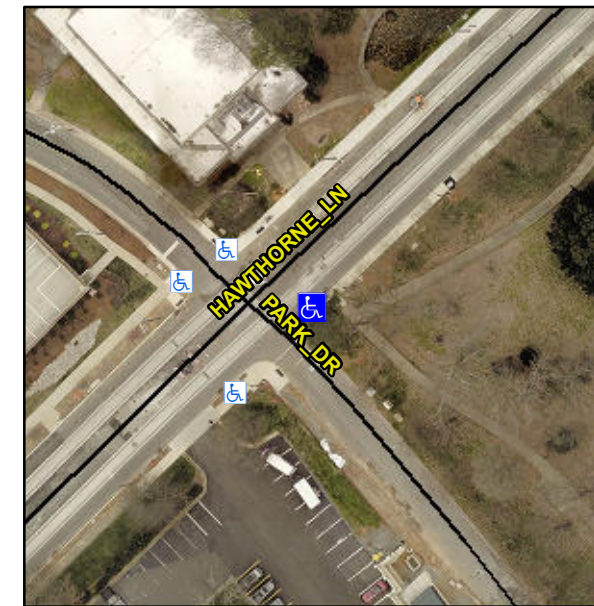

Possible Solutions:

Remove & Replace Gutter.

Surveyor Notes:

LNDG OS FROM RAMP

PROW/ADA:

R304.5.3

Total Cost:

\$ 750.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	59.0	Yes	BlendTrans Slope (%)	1.7
Yes	Ramp Width (in)	63.0	Yes	BlendTrans XSlope (%)	3.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	None
Yes	Flare Slope LT (%)	0.7	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	67.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	72.5	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.2	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.3	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.5
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	4.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.5		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.4		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	4.4		Clear Space?	Yes
	Road X Slope (%)	2.5	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	1.9

Street 1 Name	HAWTHORNE LN
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

