

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

45.0

71.0

9.2

3.2

6.6

6.8

N/A

Intersection ID: 14714 Main Street: E MOREHEAD ST Cross Street: HARDING PL Location: W **Overall Compliance: No Severity Score:** 25 ADA ID: BDCF0462E63A Ramp Type: Combination2 Initial Pass/Fail: Fail

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

N/A

Yes

No

No

Yes

No

N/A

Compliance Description

Ramp Length RT (in)

Ramp Width RT (in)

Ramp Slope RT (%)

Ramp XSlope RT (%)

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space?

Flare Traversable RT?

Data

N/A

N/A

N/A

N/A

96.0

48.0

N/A

Yes

To NE

112.0

4.4

2.5

Yes

N/A

Ramp Length LT (in)

Ramp Width LT (in)

Ramp Slope LT (%)

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Landing Length (in)

Landing Width (in)

Landing Slope (%)

Landing X Slope (%)

Landing Curb? (Y/N)

Shared Landing?

Gutter Ponding?

Gutter Lip Ht (in)

Painted X Walk1?

X Walk 1 Direction

X Walk 1 Width (in)

X Walk 1 Slope (%) X Walk 1 X Slope (%)


Ramp inside XWalk1?

Road Slope (%)

Flare Traversable LT?

Flare Type LT

Ramp XSlope LT (%)

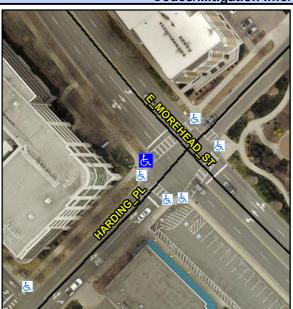

Street 1 Name Signal Stop Condition-Street 1 **E MOREHEAD ST** N/A Street 2 Name Stop Condition-Street 2 N/A Possible Solutions: Compliance Description N/A Remove & Replace Entire Ramp. N/A N/A N/A N/A Yes Surveyor Notes: N/A N/A N/A N/A N/A N/A PROW/ADA: N/A Not Found, R304.5.3, R304.3.2 N/A N/A N/A N/A N/A N/A

Total Cost:



N/A

1600.00

Road X Slope (%) N/A N/A Clear Space to XWalk (in) N/A N/A Any Obstruction? N/A **Obstruction Type** N/A N/A Storm Grate/Utility Hazard? N/A Storm Grate/Utility Type N/A Yes Surface Condition? (G/P) Good 11.7 Curb Slope (%)



