

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

53.0

57.0

6.4

0.4

0.7

0.9

N/A

N/A

11.9

Intersection ID: 31386Main Street: OAKDALE_RDCross Street: BRAVEHEART_LNLocation: WADA ID: BDFC35069C75Ramp Type: Combination1Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 22.5

Compliance Description

Ramp Length LT (in)

Ramp Width LT (in)

Ramp Slope LT (%)

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Flare Type LT

Ramp XSlope LT (%)

N/A

Yes

No

No

N/A

No

N/A

N/A

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

N/A

Yes

Yes

Yes

Yes

Yes

N/A

N/A N/A

Compliance Description

Ramp Length RT (in)

Ramp Width RT (in)

Ramp Slope RT (%)

Ramp Slope (%)

Ramp XSlope (%)

Flare Slope RT (%)

Flare Type RT

Curb Slope (%)

Ramp XSlope RT (%)

Data

59.0

50.0

8.4

2.4

48.0

36.0

N/A



Street 1 Name
StopSign
Stop Condition-Street 1
Street 2 Name
N/A
Stop Condition-Street 2
N/A

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:


RP < 5%

PROW/ADA:

Not Found, R304.5.1, R304.3.2, R304.5.3



Total Cost:

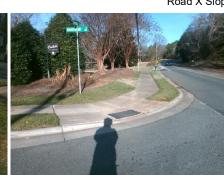

1800.00

N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.3		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
The second			N/A	Any Obstruction?	N/A
				Obstruction Type	
					N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	1
>					N/A
			Yes	Surface Condition? (G/P)	Good