


Intersection ID: 9622	Main Street: FAIRFIELD_ST	Cross Street: WASHINGTON_AV	Location:	E
ADA ID: BE47EA0618D7	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 10

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance							
	Possible Solutions:									
	Remove & Replace Entire Ramp.									
	Surveyor Notes:									
	N/A									
	PROW/ADA:									
	Not Found, R304.5.1, R304.5.3									
	Street 1 Name		WASHINGTON AV							
	Stop Condition-Street 2		StopSign							
	Street 2 Name		N/A							
	Stop Condition-Street 1		N/A							
Total Cost:		\$ 1850.00								

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	91.0	Yes	Ramp Slope (%)	6.4
No	Ramp Width (in)	47.0	No	Ramp XSlope (%)	2.5
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To S		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.5		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	3.5		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.5	N/A	Clear Space?	N/A
	Road X Slope (%)	4.5	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

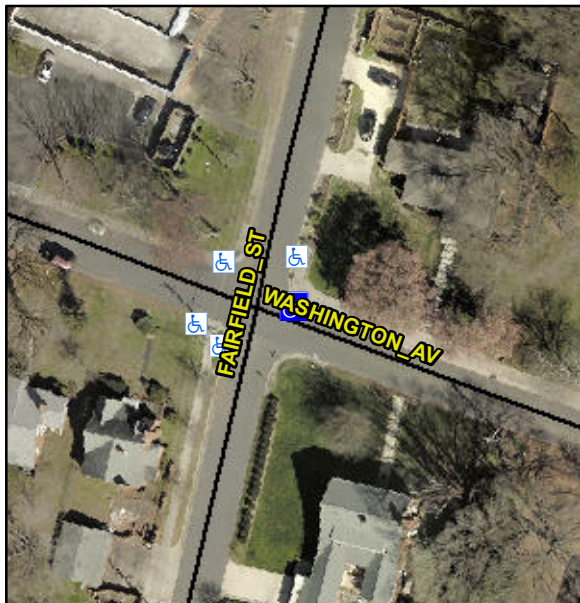