

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: ELLIOTT_ST	Cross Street: N_I-77_EXIT_10A_RA	Location: NW
ADA ID: BEA38126DEE9	Ramp Type: Combination2	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0.25	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

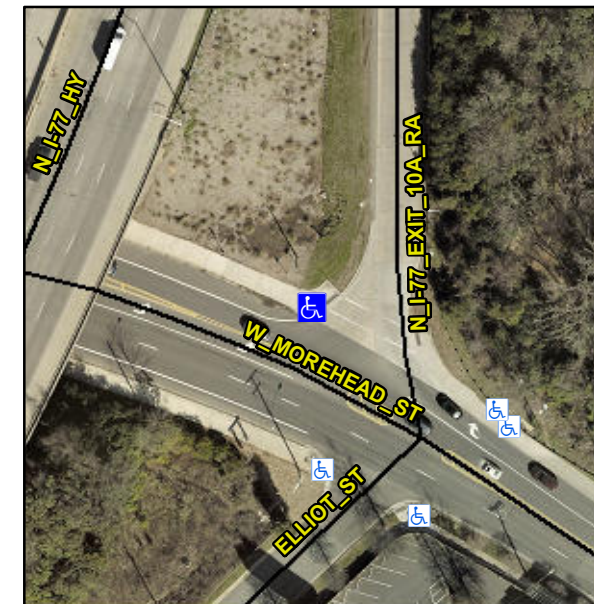

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Sidewalk.**

Surveyor Notes:

LT RP < 5%

PROW/ADA:

R304.5.3, R304.2.1, R305.2

Street 1 Name	None
Stop Condition-Street 1	N I-77 EXIT 10A RA
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 2000.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	89.0	N/A	Ramp Length RT (in)	N/A
Yes	Ramp Width LT (in)	60.0	N/A	Ramp Width RT (in)	N/A
Yes	Ramp Slope LT (%)	2.0	N/A	Ramp Slope RT (%)	N/A
No	Ramp XSlope LT (%)	3.2	N/A	Ramp XSlope RT (%)	N/A
N/A	Ramp Length (in)	60.0	Yes	Ramp Slope (%)	2.1
Yes	Ramp Width (in)	102.0	Yes	Ramp XSlope (%)	3.0
N/A	Flare Type LT	Sloped	Yes	Flare Type RT	Curbed_NoWalkSurface
Yes	Flare Slope LT (%)	3.4	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No
No	Landing Length (in)	56.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	102.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.0	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.7	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	Yes	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.2
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	4.1
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To E		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	100.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.6		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	5.0		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstruction?	No
				Obstruction Type	N/A
			Yes	Storm Grate/Utility Hazard?	No
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	4.4

