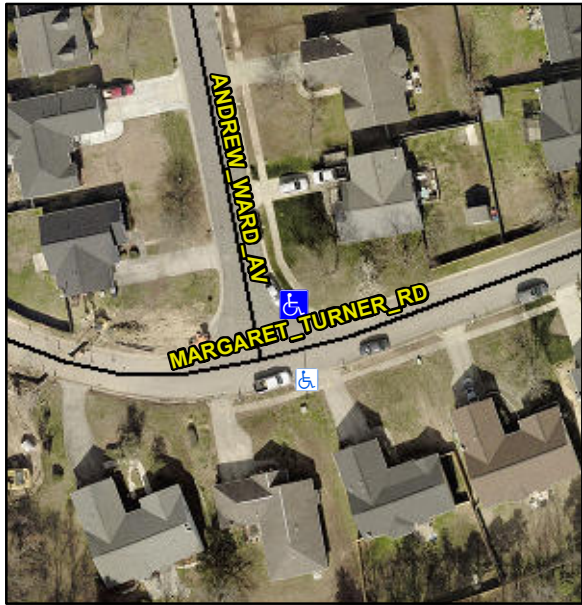


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 6851	Main Street: ANDREW_WARD_AV	Cross Street: MARGARET_TURNER_RD	Location:	N
ADA ID: BED0C8CA6D9F	Ramp Type: BlendTrans2	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	96.0	Yes	BlendTrans Slope (%)	3.4
			Yes	Ramp Width (in)	89.0	No	BlendTrans XSlope (%)	8.9
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.3</p>			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A			
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To W		X Walk 2 Direction	N/A
				X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	1.8		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	5.7		X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	5.7		Clear Space?	N/A	
			Road X Slope (%)	1.8	N/A	Clear Space to XWalk (in)	N/A	
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
			Obstruction Type			Storm Grate/Utility Type		
					N/A			N/A
					Yes	Surface Condition? (G/P)	Good	
					No	Curb Slope (%)	5.7	

