


# Access Compliance Report

## Public Rights-of-Way (Curb Ramps)

Intersection ID: 51379	Main Street: BROADRICK_BV	Cross Street: UNIVERSITY_CITY_BV	Location:	S
ADA ID: BEF3E8F820AA	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0

### Codes/Mitigation Info/Possible Solution

### Field Measurements/Component Compliance

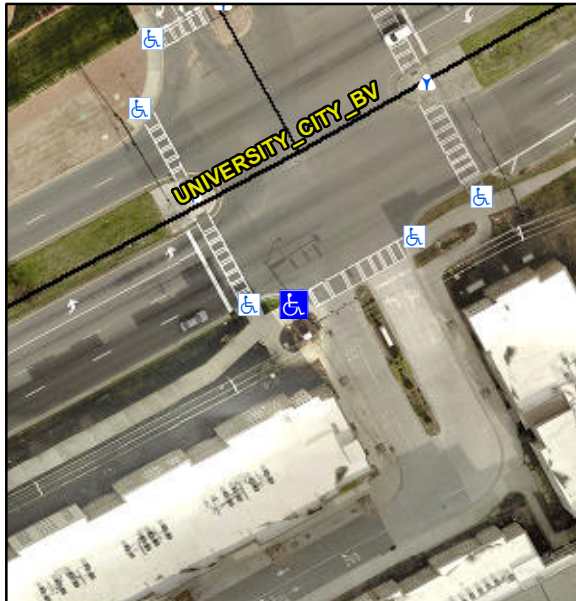

Possible Solutions:

**Remove & Replace Landing.  
Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para,  
R304.5.3**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	101.0	N/A	Grade Break?	N/A
Yes	Ramp Width (in)	117.5	N/A	Grade Break Slope (%)	2.5
Yes	Ramp Slope (%)	1.4	N/A	Grade Break XSlope (%)	0.5
Yes	Ramp XSlope (%)	0.9			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	99.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	118.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.8	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.5	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	54.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	0.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.0
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.5
N/A	Painted X Walk1?	Yes		Road Slope (%)	2.1
	X Walk 1 Direction	To NE		Road X Slope (%)	1.3
	X Walk 1 Width (in)	106.0		Clear Space?	Yes
	X Walk 1 Slope (%)	2.1	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	1.3	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	2.5

Total Cost: \$ 1250.00

