


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 15368		Main Street: KENILWORTH_AV		Cross Street: LATTIMORE_ST		Location: S							
ADA ID: BEF56BF3BF4F		Ramp Type: Directional2		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 25					
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance									
<div></div> <div>Possible Solutions: <b>Remove &amp; Replace Entire Ramp.</b></div> <div>Surveyor Notes: <b>N/A</b></div> <div>PROW/ADA: <b>R304.5.3</b></div> <div><div>Street 1 NameLATTIMORE_ST</div><div>Stop Condition-Street 1StopSign</div><div>Street 2 NameN/A</div><div>Stop Condition-Street 2N/A</div></div>				Compliance	Description	Data	Compliance	Description	Data				
				N/A	Ramp Length (in)	53.0	N/A	Grade Break?	N/A				
				Yes	Ramp Width (in)	60.0	N/A	Grade Break Slope (%)	0.0				
				Yes	Ramp Slope (%)	5.6	N/A	Grade Break XSlope (%)	0.0				
				No	Ramp XSlope (%)	8.5							
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A				
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0				
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A				
				N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A				
				N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A				
				N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A				
				N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A				
				N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A				
				N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A				
				N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A				
				N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A				
				N/A	Painted X Walk1?	No		Road Slope (%)	1.0				
					X Walk 1 Direction	To NE		Road X Slope (%)	0.0				
					X Walk 1 Width (in)	N/A		Clear Space?	N/A				
					X Walk 1 Slope (%)	1.0	N/A	Clear Space to XWalk (in)	N/A				
					X Walk 1 X Slope (%)	0.0	N/A	Storm Grate/Utility Hazard?	N/A				
				N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type					
				N/A	Any Obstructions?	N/A			N/A				
					Obstruction Type		Yes	Surface Condition? (G/P)	Good				
							N/A	Curb Slope (%)	16.4				
				Total Cost:				\$	1800.00				

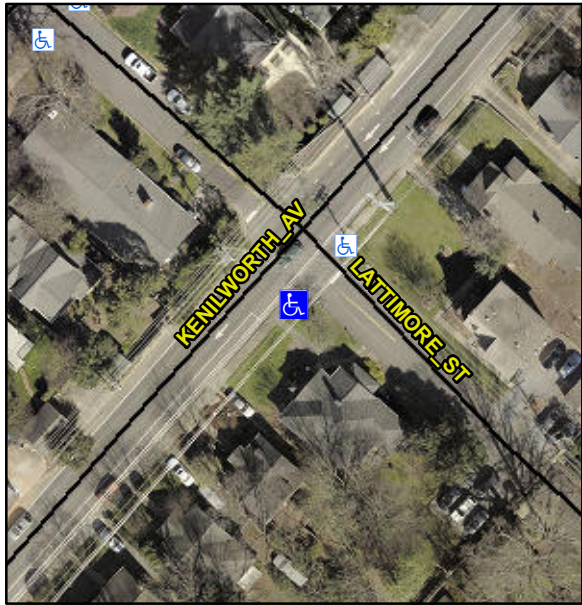