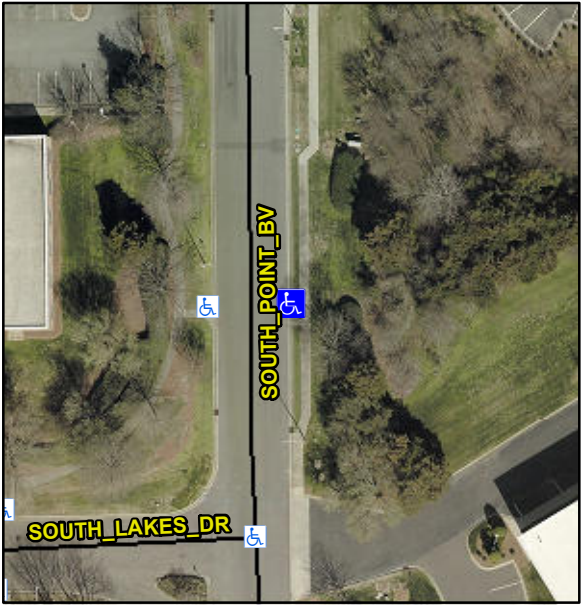
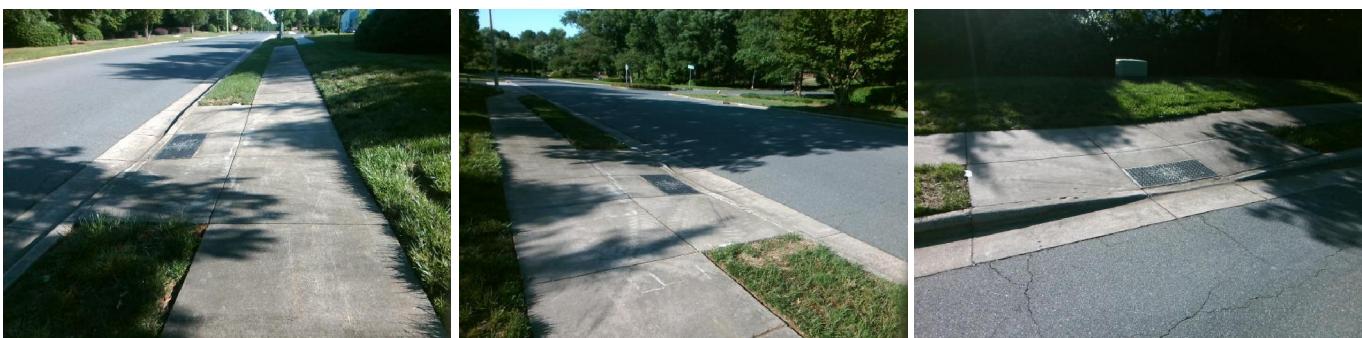


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10038412	Main Street: SOUTH_POINT_BV	Cross Street: N/A	Location:	E
ADA ID: BEF6930F3A16	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	72.0	
			Yes	Ramp Width LT (in)	59.0	
			Yes	Ramp Slope LT (%)	7.6	
			No	Ramp XSlope LT (%)	3.1	
			N/A	Ramp Length (in)	49.0	
			Yes	Ramp Width (in)	48.0	
	Surveyor Notes:		N/A	Flare Type LT	N/A	
	RT RP < 5%		N/A	Flare Slope LT (%)	N/A	
			N/A	Flare Traversable LT?	N/A	
			N/A	Landing Length (in)	N/A	
			N/A	Landing Width (in)	N/A	
			N/A	Landing Slope (%)	N/A	
			N/A	Landing X Slope (%)	N/A	
			N/A	Landing Curb? (Y/N)	N/A	
			N/A	Shared Landing?	N/A	
			N/A	Gutter Ponding?	N/A	
			N/A	Gutter Lip Ht (in)	N/A	
			N/A	Painted X Walk1?	No	
				X Walk 1 Direction	To W	
				X Walk 1 Width (in)	N/A	
				X Walk 1 Slope (%)	5.8	
				X Walk 1 X Slope (%)	3.4	
	PROW/ADA:		N/A	Ramp inside XWalk1?	N/A	
	R304.2.2, R304.5.3			Road Slope (%)	N/A	
				Road X Slope (%)	N/A	
	Total Cost:	\$ 1800.00	N/A	Ramp inside XWalk2?	N/A	
				Clear Space?	N/A	
				Clear Space to XWalk (in)	N/A	
				Any Obstruction?	N/A	
				Obstruction Type		
						N/A
				Storm Grate/Utility Hazard?	N/A	
				Storm Grate/Utility Type		
						N/A
			Yes	Surface Condition? (G/P)	Good	
				Curb Slope (%)	0.7	