

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 16897	Main Street: MONTAGUE_ST	Cross Street: SUMMEY_AV	Location: S
ADA ID: BFC2C5601F17	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

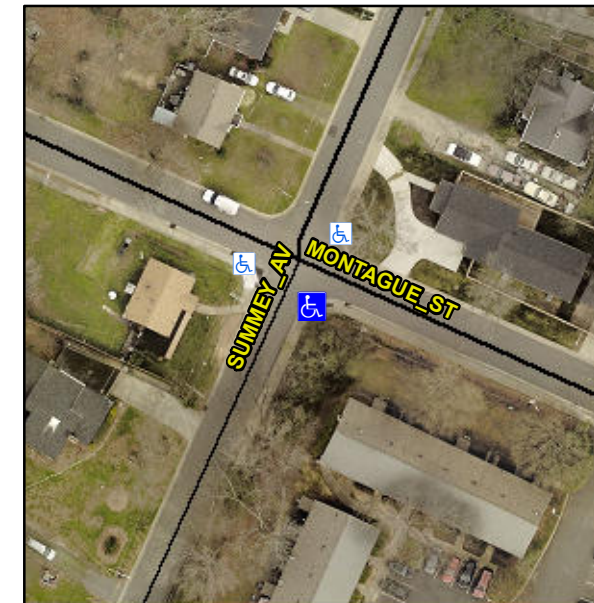

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

RT RP < 5%,

PROW/ADA:

R304.5.1, R304.3.2

Street 1 Name	MONTAGUE ST
Stop Condition-Street 1	None
Street 2 Name	SUMMEY AV
Stop Condition-Street 2	StopSign

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	69.0	N/A	Ramp Length RT (in)	64.0
Yes	Ramp Width LT (in)	48.0	No	Ramp Width RT (in)	47.0
No	Ramp Slope LT (%)	10.0	Yes	Ramp Slope RT (%)	2.5
Yes	Ramp XSlope LT (%)	0.0	Yes	Ramp XSlope RT (%)	1.9
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.7		X Walk 2 Slope (%)	2.1
	X Walk 1 X Slope (%)	3.1		X Walk 2 X Slope (%)	7.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	5.7	N/A	Clear Space?	N/A
	Road X Slope (%)	9.9	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	13.4

