


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 44471	Main Street: COREY_COMMON_AV	Cross Street: REDDING_GLEN_AV	Location: NE
ADA ID: BFC8CF6B238E	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

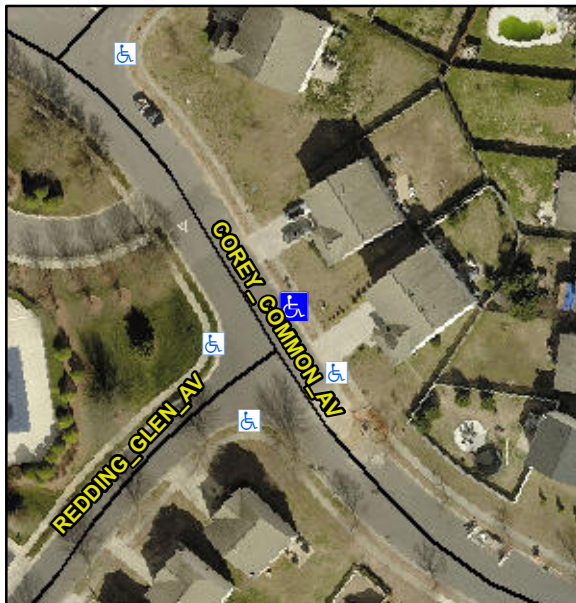

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**Not Found, R304.2.2, R304.5.3,
R304.2.1, R304.2.2-Perp, R304.3.2-
Para, R302.7.2, R304.5.4**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	No	Ramp Slope (%)	9.1
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.2
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
No	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
No	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
Yes	Gutter Ponding?	N/A	No	Gutter Slope (%)	N/A
No	Gutter Lip Ht (in)	N/A	No	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	7.1		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.0		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	N/A	Yes	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 2600.00

