


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 10036726 Main Street: S_COLLEGE_ST Cross Street: N/A Location: SE ADA ID: BFD81E10F77E Ramp Type: Perp Initial Pass/Fail: Fail **Overall Compliance: No Severity Score:** 12.5

Codes/Mitigation Info/Possible Solution

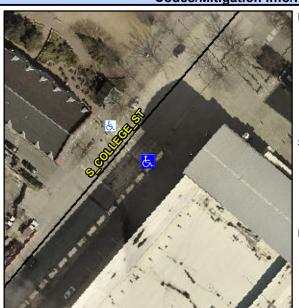

Street 1 Name	S COLLEGE ST
Stop Condition-Street 2	Signal
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Possible Solutions: Remove & Replace Entire Ramp. Surveyor Notes: N/A PROW/ADA: Not Found, R304.2.2

Total Cost:	\$ 1850.00

Field Measurements/Component Compliance								
Comp	liance Description	Data	Comp	liance	Description	Data		
N/A	Ramp Length (in)	64.0	No	Ramp	Slope (%)	9.0		
Yes	Ramp Width (in)	48.0	Yes	Yes Ramp XSlope (%)				
N/A	Flare Type LT	N/A	N/A	N/A Flare Type RT				
N/A	Flare Slope LT (%)	N/A	N/A	N/A Flare Slope RT (%)				
N/A	Flare Traversable LT?	N/A	N/A	Flare	Traversable RT?	N/A		
N/A	Landing Length (in)	N/A	N/A	DWS	Provided?	N/A		
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?		N/A		
N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)	N/A		
N/A	Landing X Slope (%)	N/A	N/A	DWS	Full Width?	N/A		
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N/A		
N/A	Shared Landing?	N/A						
N/A	Gutter Ponding?	N/A	N/A	Gutte	r Slope (%)	N/A		
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutte	r X Slope (%)	N/A		
N/A	Painted X Walk1?	Yes	N/A	Paint	ed X Walk2?	N/A		
	X Walk 1 Direction	To NW		X Wa	lk 2 Direction	N/A		
N/A	X Walk 1 Width (in)	115.0	N/A	X Wa	lk 2 Width (in)	N/A		
	X Walk 1 Slope (%)	2.7		X Wa	lk 2 Slope (%)	N/A		
	X Walk 1 X Slope (%)	3.0		X Wa	lk 2 X Slope (%)	N/A		
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp	inside XWalk2?	N/A		
	Road Slope (%)	N/A	N/A	Clear	Space?	N/A		
	Road X Slope (%)	N/A	N/A	Clear	Space to XWalk (in)	N/A		
N/A	Any Obstructions?	N/A	N/A	Storm	n Grate/Utility Hazard?	N/A		
	Obstruction Type			Storm	n Grate/Utility Type			
		N/A				N/A		
			Yes	Surfa	ce Condition? (G/P)	Good		
-								





