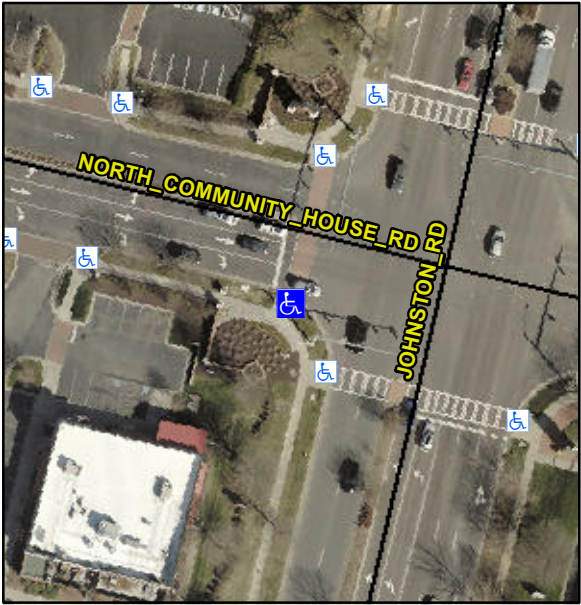


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 43922	Main Street: NORTH_COMMUNITY_HOUSE_RD	Cross Street: JOHNSTON_RD	Location: SW
ADA ID: BFD88FAF2324	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 10	

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
	Possible Solutions:				
	Remove & Replace Entire Ramp.				
	Surveyor Notes:				
	N/A				
	PROW/ADA:				
	Not Found, R304.5.1, R304.5.3				
	Street 1 Name	NORTH COMMUNITY HOUSE RD		Stop Condition-Street 2	Signal
	Street 2 Name	N/A		Stop Condition-Street 1	N/A
	Total Cost:	\$	1850.00		
		Compliance	Description	Data	Compliance
		N/A	Ramp Length (in)	117.0	Yes
		No	Ramp Width (in)	38.0	No
		N/A	Flare Type LT	N/A	N/A
		N/A	Flare Slope LT (%)	N/A	N/A
		N/A	Flare Traversable LT?	N/A	N/A
		N/A	Landing Length (in)	N/A	N/A
		N/A	Landing Width (in)	N/A	N/A
		N/A	Landing Slope (%)	N/A	N/A
		N/A	Landing X Slope (%)	N/A	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A
		N/A	Shared Landing?	N/A	N/A
		N/A	Gutter Ponding?	N/A	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A
		N/A	Painted X Walk1?	Yes	N/A
			X Walk 1 Direction	To NE	
		N/A	X Walk 1 Width (in)	118.0	N/A
			X Walk 1 Slope (%)	0.5	
			X Walk 1 X Slope (%)	2.5	
		N/A	Ramp inside XWalk1?	Yes	N/A
			Road Slope (%)	N/A	N/A
			Road X Slope (%)	N/A	N/A
		N/A	Any Obstructions?	N/A	N/A
			Obstruction Type		
				N/A	N/A
				Yes	Surface Condition? (G/P)
					Good

