


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 20051	Main Street: ARCHDALE_DR	Cross Street: BURNLEY_RD	Location:	S
ADA ID: C02CF6C6D548	Ramp Type: Combination2Diag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

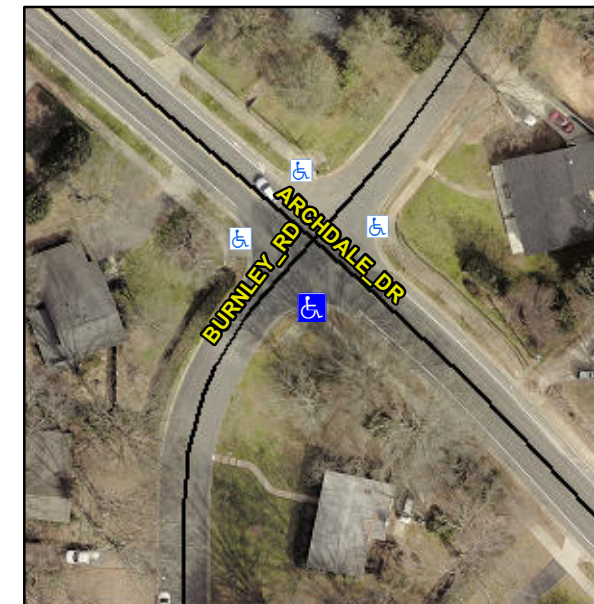

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.1, R304.2.2, R304.5.3**

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	26.0	N/A	Ramp Length RT (in)	N/A
Yes	Ramp Width LT (in)	72.0	N/A	Ramp Width RT (in)	N/A
Yes	Ramp Slope LT (%)	6.4	N/A	Ramp Slope RT (%)	N/A
No	Ramp XSlope LT (%)	3.9	N/A	Ramp XSlope RT (%)	N/A
N/A	Ramp Length (in)	71.5	No	Ramp Slope (%)	8.6
No	Ramp Width (in)	46.0	No	Ramp XSlope (%)	3.9
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.5		X Walk 2 Slope (%)	5.0
	X Walk 1 X Slope (%)	0.8		X Walk 2 X Slope (%)	4.4
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.9		Clear Space?	N/A
	Road X Slope (%)	6.1	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	9.0

