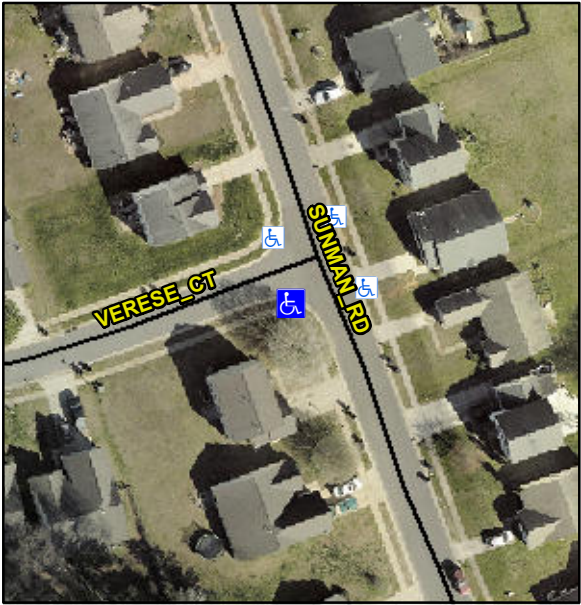


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 31516	Main Street: SUNMAN_RD	Cross Street: VERESE_CT	Location: SW
ADA ID: C0819A5C1B17	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	Compliance
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		Description		Data	Description
<p>Surveyor Notes:</p> <p>N/A</p>	PROW/ADA:		N/A	Ramp Length (in)	47.5	Yes
	R304.2.2-Perp, R304.3.2-Para, R305.2		Yes	Ramp Width (in)	98.0	Yes
<p>Total Cost:</p> <p>\$ 3200.00</p>			N/A	Flare Type LT	Sloped	N/A
			N/A	Flare Slope LT (%)	3.2	Yes
			N/A	Flare Traversable LT?	Yes	N/A
			Yes	Flare Slope RT (%)	2.3	Yes
			Yes	Flare Traversable RT?	Yes	N/A
			Yes	Landing Length (in)	90.5	Yes
			Yes	Landing Width (in)	48.5	Yes
			No	DWS Provided?	Yes	Yes
			Yes	Landing Slope (%)	3.1	Yes
			Yes	DWS Contrast?	Yes	Yes
			Yes	DWS Length (in)	24.0	Yes
			Yes	DWS Full Width?	Yes	Yes
			N/A	DWS Offset (in)	3.0	No
			N/A			
			N/A	Shared Landing?	No	No
			Yes	Gutter Ponding?	No	Yes
			Yes	Gutter Slope (%)	1.6	Yes
			Yes	Gutter Lip Ht (in)	0.0	Yes
			Yes	Gutter X Slope (%)	1.7	Yes
			N/A	Painted X Walk1?	No	N/A
			N/A	Painted X Walk2?	No	N/A
			N/A	X Walk 1 Direction	To E	To W
			N/A	X Walk 2 Direction	To W	To W
			N/A	X Walk 1 Width (in)	N/A	N/A
			N/A	X Walk 2 Width (in)	N/A	N/A
			N/A	X Walk 1 Slope (%)	1.9	N/A
			N/A	X Walk 2 Slope (%)	0.0	N/A
			N/A	X Walk 1 X Slope (%)	1.8	N/A
			N/A	X Walk 2 X Slope (%)	3.0	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A
			N/A	Ramp inside XWalk2?	N/A	N/A
			N/A	Road Slope (%)	1.2	N/A
			N/A	Clear Space?	Yes	Yes
			N/A	Clear Space to XWalk (in)	N/A	N/A
			Yes	Storm Grate/Utility Hazard?	No	No
			Yes	Storm Grate/Utility Type		
			N/A			N/A
			N/A			N/A
			Yes	Surface Condition? (G/P)	Good	Good

