


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 50708	Main Street: CELEBRATION_RD	Cross Street: BROTHERLY_LN	Location: SE
ADA ID: C1507DF426FD	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 2.75			

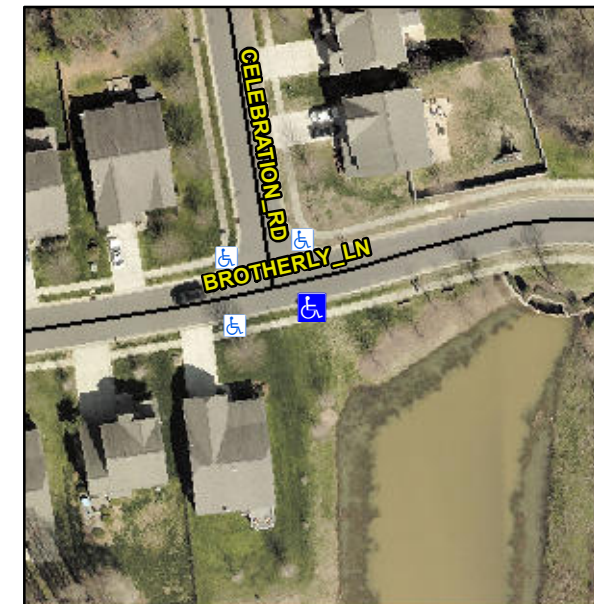

Possible Solutions:

Remove & Replace Flare. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.3, R304.5.3

Total Cost: \$ 1050.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	49.0	Yes	Ramp Slope (%)	7.7
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	2.7
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	0.5	No	Flare Slope RT (%)	11.5
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.3	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	3.7	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.0
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	4.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	3.9		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name **BROTHERLY LN**

Stop Condition-Street 2 **None**

Street 2 Name **N/A**

Stop Condition-Street 1 **N/A**

