


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 15435		Main Street: LATTIMORE_ST		Cross Street: SCOTT_AV		Location: N					
ADA ID: C192771C5AED		Ramp Type: Directional1		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 21.25			
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance							
				Possible Solutions:		Compliance		Description		Data	
				Remove & Replace Entire Ramp.		N/A		Ramp Length (in)		44.0	
Surveyor Notes:				N/A		No		Ramp Width (in)		37.0	
						Yes		Ramp Slope (%)		5.8	
PROW/ADA:				R304.5.1, R304.5.3		No		Ramp XSlope (%)		6.2	
						N/A		Flare Type LT		N/A	
						N/A		Flare Slope LT (%)		N/A	
						N/A		Flare Traversable LT?		N/A	
						N/A		Landing Length (in)		0.0	
						N/A		Landing Width (in)		0.0	
						N/A		Landing Slope (%)		0.0	
						N/A		Landing X Slope (%)		0.0	
						N/A		Landing Curb? (Y/N)		N/A	
						N/A		Shared Landing?		N/A	
						N/A		Gutter Ponding?		0.0	
						N/A		Gutter Lip Ht (in)		0.0	
						N/A		Painted X Walk1?		No	
								X Walk 1 Direction		To SW	
						N/A		X Walk 1 Width (in)		N/A	
						N/A		X Walk 1 Slope (%)		3.3	
								X Walk 1 X Slope (%)		3.4	
						N/A		Ramp inside XWalk1?		N/A	
						N/A		Any Obstructions?		N/A	
								Obstruction Type		Yes	
								Surface Condition? (G/P)		Good	
								N/A		N/A	
										5.7	
Street 1 Name				LATTIMORE ST							
Stop Condition-Street 1				StopSign							
Street 2 Name				N/A							
Stop Condition-Street 2				N/A							
Total Cost:				\$		1600.00					

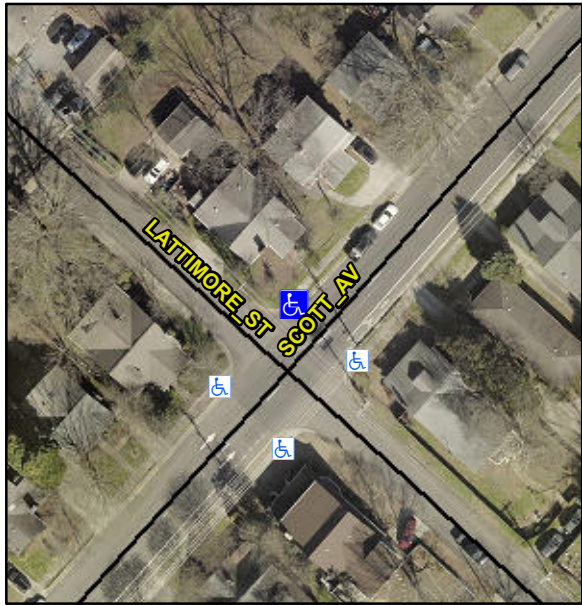