

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

|                        |                            |                           |                        |
|------------------------|----------------------------|---------------------------|------------------------|
| Intersection ID: 24484 | Main Street: SAINTFIELD_PL | Cross Street: SWINFORD_PL | Location: NW           |
| ADA ID: C1C12F4DF41D   | Ramp Type: Perp            | Initial Pass/Fail: Pass   | Overall Compliance: No |
|                        |                            | Severity Score: 15        |                        |

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

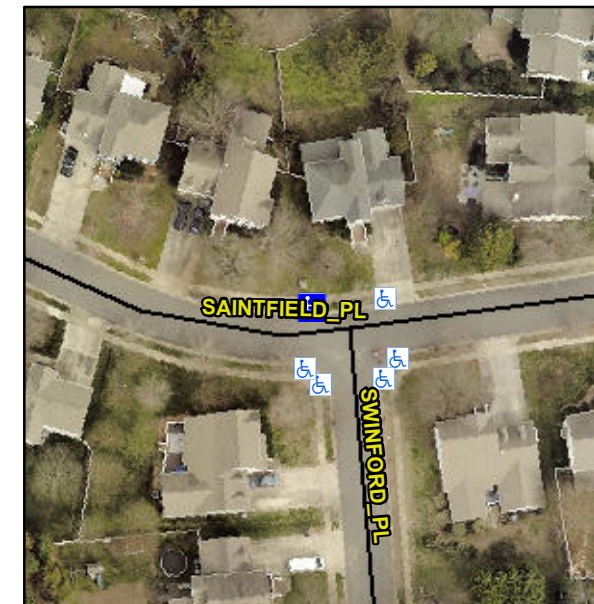

Possible Solutions:

**Remove & Replace Entire Ramp.  
Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.2.1, R304.2.2-Perp, R304.3.2-  
Para, R305, R302.7, R304.5.4**

Total Cost: \$ 2600.00

| Compliance | Description           | Data   | Compliance | Description                 | Data |
|------------|-----------------------|--------|------------|-----------------------------|------|
| N/A        | Ramp Length (in)      | 48.0   | Yes        | Ramp Slope (%)              | 7.3  |
| Yes        | Ramp Width (in)       | 48.0   | Yes        | Ramp XSlope (%)             | 1.3  |
| N/A        | Flare Type LT         | Sloped | N/A        | Flare Type RT               | N/A  |
| N/A        | Flare Slope LT (%)    | 3.6    | Yes        | Flare Slope RT (%)          | 6.6  |
| N/A        | Flare Traversable LT? | Yes    | N/A        | Flare Traversable RT?       | Yes  |
| No         | Landing Length (in)   | 45.0   | No         | DWS Provided?               | No   |
| Yes        | Landing Width (in)    | 48.0   | N/A        | DWS Contrast?               | No   |
| No         | Landing Slope (%)     | 5.2    | N/A        | DWS Length (in)             | N/A  |
| Yes        | Landing X Slope (%)   | 1.4    | N/A        | DWS Full Width?             | No   |
| N/A        | Landing Curb? (Y/N)   | No     | N/A        | DWS Offset (in)             | N/A  |
| N/A        | Shared Landing?       | No     |            |                             |      |
| No         | Gutter Ponding?       | Yes    | No         | Gutter Slope (%)            | 10.6 |
| Yes        | Gutter Lip Ht (in)    | 0.0    | Yes        | Gutter X Slope (%)          | 1.1  |
| N/A        | Painted X Walk1?      | No     | N/A        | Painted X Walk2?            | N/A  |
|            | X Walk 1 Direction    | To S   |            | X Walk 2 Direction          | N/A  |
| N/A        | X Walk 1 Width (in)   | N/A    | N/A        | X Walk 2 Width (in)         | N/A  |
|            | X Walk 1 Slope (%)    | 2.8    |            | X Walk 2 Slope (%)          | N/A  |
|            | X Walk 1 X Slope (%)  | 0.2    |            | X Walk 2 X Slope (%)        | N/A  |
| N/A        | Ramp inside XWalk1?   | N/A    | N/A        | Ramp inside XWalk2?         | N/A  |
|            | Road Slope (%)        | N/A    | N/A        | Clear Space?                | Yes  |
|            | Road X Slope (%)      | N/A    | N/A        | Clear Space to XWalk (in)   | N/A  |
| Yes        | Any Obstructions?     | No     | Yes        | Storm Grate/Utility Hazard? | No   |
|            | Obstruction Type      |        |            | Storm Grate/Utility Type    |      |
|            |                       | N/A    |            |                             | N/A  |
|            |                       |        | Yes        | Surface Condition? (G/P)    | Good |

