


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10037388		Main Street: SCALEYBARK_RD		Cross Street: N/A		Location:		SW	
ADA ID: C2131D94FB9D		Ramp Type: Para		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 12.5	
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
		Possible Solutions:		Compliance		Description		Data	
		Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	N/A	N/A	Ramp Length RT (in)	72.0
				N/A	Ramp Width LT (in)	N/A	Yes	Ramp Width RT (in)	60.0
				N/A	Ramp Slope LT (%)	N/A	No	Ramp Slope RT (%)	9.7
				N/A	Ramp XSlope LT (%)	N/A	Yes	Ramp XSlope RT (%)	1.9
				N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
				N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
				N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
				N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
				N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
Surveyor Notes:  N/A				N/A	Shared Landing?	N/A			
				N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
				N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
				N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
					X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
				N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
					X Walk 1 Slope (%)	2.0		X Walk 2 Slope (%)	N/A
					X Walk 1 X Slope (%)	2.6		X Walk 2 X Slope (%)	N/A
				N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
					Road Slope (%)	N/A	N/A	Clear Space?	N/A
PROW/ADA:  R304.3.2					Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
				N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
					Obstruction Type			Storm Grate/Utility Type	
							N/A		N/A
							Yes	Surface Condition? (G/P)	Good
							N/A	Curb Slope (%)	14.5
Street 1 Name		SCALEYBARK RD							
Stop Condition-Street 1		None							
Street 2 Name		N/A							
Stop Condition-Street 2		N/A							
Total Cost:		\$ 1600.00							

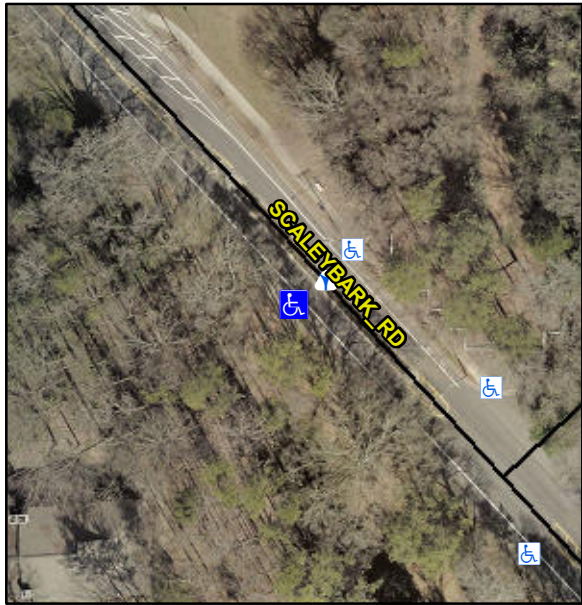