


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 7091	Main Street: BROOKSHIRE_BV	Cross Street: HOVIS_RD	Location:	N
ADA ID: C21EA804E327	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 2.75
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

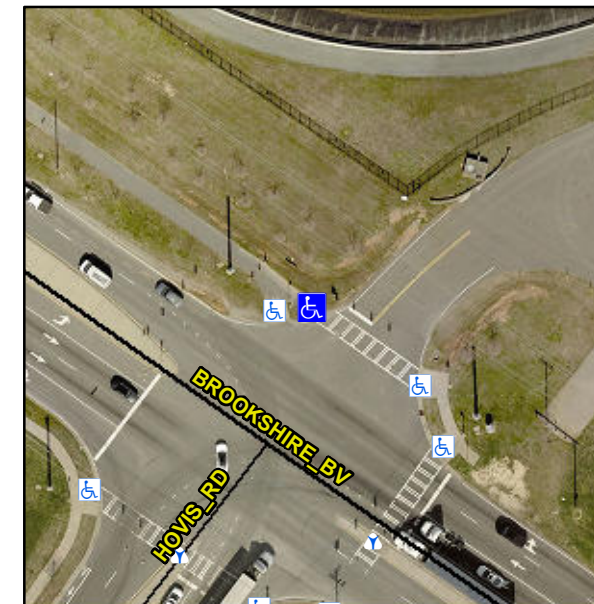

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**NO CURB. DWS OS MEASURED TO ASP**

PROW/ADA:

**R304.5.3, R305.1.4, R305.2**

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	24.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	110.0	Yes	Grade Break Slope (%)	0.9
Yes	Ramp Slope (%)	0.9	No	Grade Break XSlope (%)	2.8
No	Ramp XSlope (%)	2.1			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	110.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.0	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.2	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset LT (in)	12.0
N/A	Shared Landing?	No	No	DWS Offset RT (in)	73.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.2
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.7
N/A	Painted X Walk1?	Yes		Road Slope (%)	1.1
	X Walk 1 Direction	To SE		Road X Slope (%)	1.3
	X Walk 1 Width (in)	111.0		Clear Space?	Yes
	X Walk 1 Slope (%)	1.1	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	1.3	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	2.0

