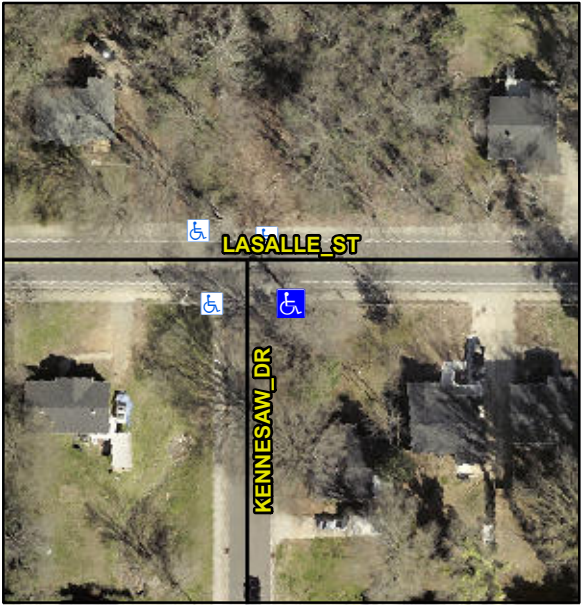


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 8483	Main Street: KENNESAW_DR	Cross Street: LASALLE_ST	Location: SE
ADA ID: C24480FBDA26	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
	Possible Solutions:	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.					
	Surveyor Notes:	N/A					
	PROW/ADA:	Not Found, R304.5.1, R304.5.3					
			Compliance	Description	Data	Compliance	Description
			N/A	Ramp Length (in)	59.5	Yes	Ramp Slope (%)
			No	Ramp Width (in)	36.0	No	Ramp XSlope (%)
			N/A	Flare Type LT	N/A	N/A	Flare Type RT
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)
			N/A	Shared Landing?	N/A		
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)
			N/A	Gutter Lip Ht (in)	0.5	N/A	Gutter X Slope (%)
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?
				X Walk 1 Direction	To N		X Walk 2 Direction
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)
				X Walk 1 Slope (%)	4.6		X Walk 2 Slope (%)
				X Walk 1 X Slope (%)	5.4		X Walk 2 X Slope (%)
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?
				Road Slope (%)	2.2	N/A	Clear Space?
				Road X Slope (%)	7.9	N/A	Clear Space to XWalk (in)
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?
				Obstruction Type			Storm Grate/Utility Type
					N/A		N/A
						Yes	Surface Condition? (G/P)
							Good

Street 1 Name	LASALLE ST
Stop Condition-Street 2	None
Street 2 Name	KENNESAW DR
Stop Condition-Street 1	StopSign

Total Cost: \$ 3200.00

