

## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Intersection ID: N/A Main Street: S BREVARD ST Cross Street: E 3RD ST Location:

Initial Pass/Fail: Fail **Overall Compliance: No ADA ID: C25E1E0C829E** Ramp Type: Perp Severity Score: 13.75


Compliance Description

## **Codes/Mitigation Info/Possible Solution**

## Field Measurements/Component Compliance

Compliance Description

Data

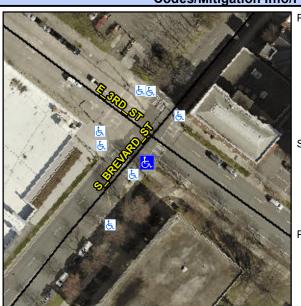

E 3RD ST Street 1 Name Stop Condition-Street 2 Signal N/A Street 2 Name Stop Condition-Street 1 N/A

Possible Solutions: Remove & Replace Entire Ramp. Surveyor Notes: N/A PROW/ADA: Not Found, R304.2.2, R304.5.3

Total Cost: 1850.00

Data No N/A Ramp Length (in) 72.0 Ramp Slope (%) 9.9 No Ramp XSlope (%) Yes Ramp Width (in) 48.0 4.9 N/A N/A Flare Type LT N/A Flare Type RT N/A N/A N/A N/A Flare Slope RT (%) Flare Slope LT (%) N/A N/A Flare Traversable LT? Nο N/A Flare Traversable RT? No N/A N/A N/A **DWS Provided?** N/A Landing Length (in) N/A Landing Width (in) N/A N/A **DWS Contrast?** N/A N/A N/A N/A Landing Slope (%) DWS Length (in) N/A N/A Landing X Slope (%) N/A N/A DWS Full Width? N/A N/A Landing Curb? (Y/N) N/A N/A DWS Offset (in) N/A N/A N/A Shared Landing? N/A **Gutter Ponding?** N/A N/A Gutter Slope (%) N/A N/A Gutter Lip Ht (in) N/A N/A Gutter X Slope (%) N/A N/A Painted X Walk1? Yes N/A Painted X Walk2? N/A X Walk 1 Direction To NE X Walk 2 Direction N/A N/A 111.0 N/A X Walk 1 Width (in) X Walk 2 Width (in) N/A X Walk 1 Slope (%) 0.2 X Walk 2 Slope (%) N/A X Walk 1 X Slope (%) 1.8 X Walk 2 X Slope (%) N/A N/A N/A Ramp inside XWalk2? Ramp inside XWalk1? Yes N/A Road Slope (%) N/A N/A Clear Space? N/A Road X Slope (%) N/A N/A Clear Space to XWalk (in) N/A N/A N/A Any Obstructions? N/A Storm Grate/Utility Hazard? N/A **Obstruction Type** Storm Grate/Utility Type N/A N/A Yes Surface Condition? (G/P) Good





