


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

| | | | | |
|---|------------------------------|---|------------------------|----------------------|
| Intersection ID: 52288 | Main Street: STEELE_CREEK_RD | Cross Street: DIXIE_RIVER_RD | Location: | N |
| ADA ID: C2DBF222BCA5 | Ramp Type: Para | Initial Pass/Fail: Fail | Overall Compliance: No | Severity Score: 12.5 |
| Codes/Mitigation Info/Possible Solution | | Field Measurements/Component Compliance | | |

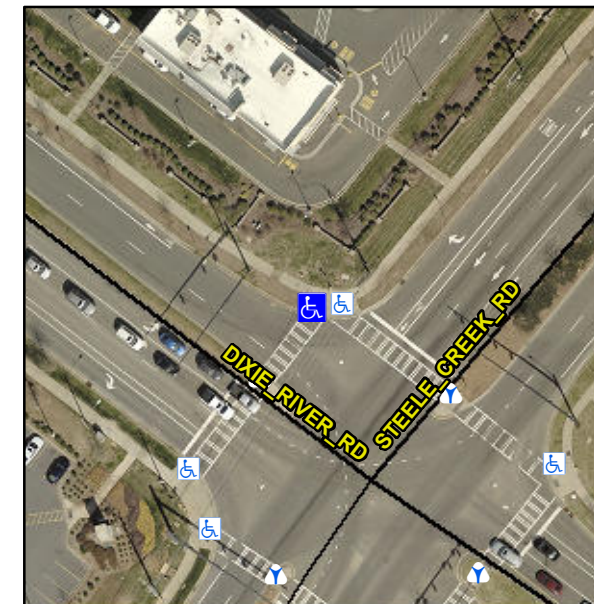

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

RT RP < 5%

PROW/ADA:

R304.3.2

| | |
|-------------------------|----------------|
| Street 1 Name | DIXIE RIVER RD |
| Stop Condition-Street 1 | Signal |
| Street 2 Name | N/A |
| Stop Condition-Street 2 | N/A |

Total Cost: \$ 1600.00

| Compliance | Description | Data | Compliance | Description | Data |
|------------|----------------------|-------|------------|-----------------------------|------|
| N/A | Ramp Length LT (in) | 53.0 | N/A | Ramp Length RT (in) | 56.5 |
| Yes | Ramp Width LT (in) | 96.0 | Yes | Ramp Width RT (in) | 95.0 |
| No | Ramp Slope LT (%) | 9.0 | Yes | Ramp Slope RT (%) | 4.0 |
| Yes | Ramp XSlope LT (%) | 1.0 | Yes | Ramp XSlope RT (%) | 1.9 |
| N/A | Landing Length (in) | N/A | N/A | DWS Provided? | N/A |
| N/A | Landing Width (in) | N/A | N/A | DWS Contrast? | N/A |
| N/A | Landing Slope (%) | N/A | N/A | DWS Length (in) | N/A |
| N/A | Landing X Slope (%) | N/A | N/A | DWS Full Width? | N/A |
| N/A | Landing Curb? (Y/N) | N/A | N/A | DWS Offset (in) | N/A |
| N/A | Shared Landing? | N/A | | | |
| N/A | Gutter Ponding? | N/A | N/A | Gutter Slope (%) | N/A |
| N/A | Gutter Lip Ht (in) | N/A | N/A | Gutter X Slope (%) | N/A |
| N/A | Painted X Walk1? | Yes | N/A | Painted X Walk2? | N/A |
| | X Walk 1 Direction | To SW | | X Walk 2 Direction | N/A |
| N/A | X Walk 1 Width (in) | 112.0 | N/A | X Walk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 2.9 | | X Walk 2 Slope (%) | N/A |
| | X Walk 1 X Slope (%) | 1.8 | | X Walk 2 X Slope (%) | N/A |
| N/A | Ramp inside XWalk1? | Yes | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | N/A | N/A | Clear Space? | N/A |
| | Road X Slope (%) | N/A | N/A | Clear Space to XWalk (in) | N/A |
| N/A | Any Obstructions? | N/A | N/A | Storm Grate/Utility Hazard? | N/A |
| | Obstruction Type | | | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |
| | | | N/A | Curb Slope (%) | 6.1 |

