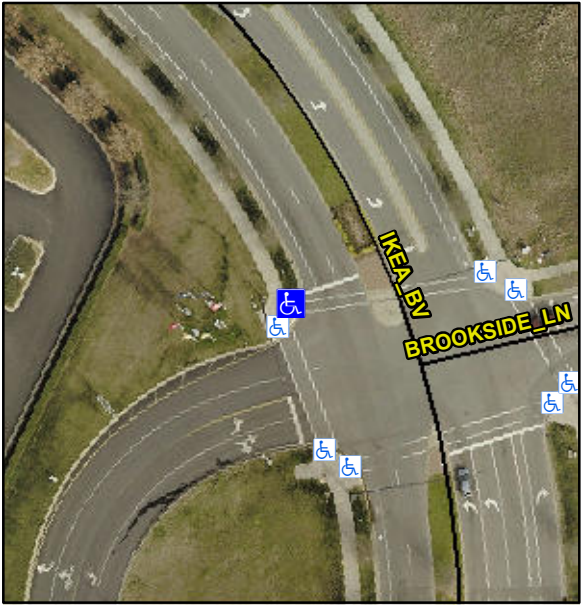


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                        |                      |                            |                        |
|------------------------|----------------------|----------------------------|------------------------|
| Intersection ID: 51704 | Main Street: IKEA_BV | Cross Street: BROOKSIDE_LN | Location: NW           |
| ADA ID: C30867EA8A6D   | Ramp Type: Perp      | Initial Pass/Fail: Fail    | Overall Compliance: No |
|                        |                      | Severity Score: 8.75       |                        |

| Codes/Mitigation Info/Possible Solution   |  |  | Field Measurements/Component Compliance |                       |             |                          |
|---|--|--|---|-----------------------|-------------|--------------------------|
|             | Possible Solutions:                      |  | <b>Compliance</b>                       | <b>Description</b>    | <b>Data</b> | <b>Compliance</b>        |
|   | <b>Remove &amp; Replace Entire Ramp.</b> |  | <b>Description</b>                      |                       |             | <b>Description</b>       |
|   |  |  | <b>Data</b>                             |                       |             | <b>Data</b>              |
|   |  |  | N/A                                     | Ramp Length (in)      | 102.0       | Yes                      |
|   |  |  | No                                      | Ramp Width (in)       | 46.5        | Yes                      |
|   |  |  | N/A                                     | Flare Type LT         | N/A         | N/A                      |
|   |  |  | N/A                                     | Flare Slope LT (%)    | N/A         | N/A                      |
|   |  |  | N/A                                     | Flare Traversable LT? | N/A         | N/A                      |
|   |  |  | N/A                                     | Landing Length (in)   | N/A         | N/A                      |
|   |  |  | N/A                                     | Landing Width (in)    | N/A         | N/A                      |
| <p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>Not Found, R304.5.1</b></p> |  |  | N/A                                     | Flare Type RT         | N/A         | N/A                      |
|   |  |  | N/A                                     | Flare Slope RT (%)    | N/A         | N/A                      |
|   |  |  | N/A                                     | Flare Traversable RT? | N/A         | N/A                      |
|   |  |  | N/A                                     | DWS Provided?         | N/A         | N/A                      |
|   |  |  | N/A                                     | DWS Contrast?         | N/A         | N/A                      |
|   |  |  | N/A                                     | DWS Length (in)       | N/A         | N/A                      |
|   |  |  | N/A                                     | DWS Full Width?       | N/A         | N/A                      |
|   |  |  | N/A                                     | DWS Offset (in)       | N/A         | N/A                      |
|   |  |  | N/A                                     | Gutter Ponding?       | N/A         | N/A                      |
|   |  |  | N/A                                     | Gutter Lip Ht (in)    | 0.5         | N/A                      |
|   |  |  | N/A                                     | Painted X Walk1?      | Yes         | N/A                      |
|   |  |  |   | X Walk 1 Direction    | To E        | N/A                      |
|   |  |  | N/A                                     | X Walk 1 Width (in)   | 60.0        | N/A                      |
|   |  |  |   | X Walk 1 Slope (%)    | 2.5         | N/A                      |
|   |  |  |   | X Walk 1 X Slope (%)  | 0.3         | N/A                      |
|   |  |  | N/A                                     | Ramp inside XWalk1?   | Yes         | N/A                      |
|   |  |  |   | Road Slope (%)        | N/A         | N/A                      |
|   |  |  |   | Road X Slope (%)      | N/A         | N/A                      |
|   |  |  | N/A                                     | Any Obstructions?     | N/A         | N/A                      |
|   |  |  |   | Obstruction Type      |             | N/A                      |
| Total Cost:   |  |  | \$                                      | 1850.00               |             | N/A                      |
|   |  |  |   |                       |             | Yes                      |
|   |  |  |   |                       |             | Surface Condition? (G/P) |
|   |  |  |   |                       |             | Good                     |

