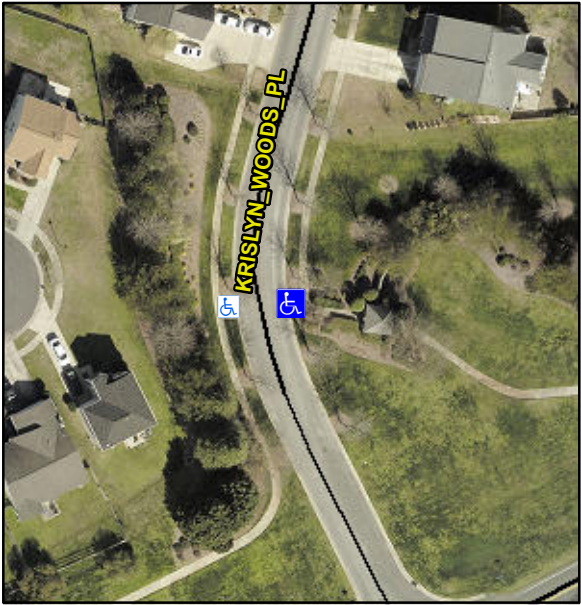


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10029840	Main Street: KRISLYN_WOODS_PL	Cross Street: N/A	Location: NE
ADA ID: C3B5B3723F45	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 12.5			

	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	80.0	N/A	Grade Break?	N/A
			Yes	Ramp Width (in)	48.0	N/A	Grade Break Slope (%)	0.0
			No	Ramp Slope (%)	9.2	N/A	Grade Break XSlope (%)	0.0
			Yes	Ramp XSlope (%)	0.8			
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
			N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
			N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No		Road Slope (%)	3.4
				X Walk 1 Direction	To SW		Road X Slope (%)	1.4
				X Walk 1 Width (in)	N/A		Clear Space?	N/A
				X Walk 1 Slope (%)	3.4	N/A	Clear Space to XWalk (in)	N/A
				X Walk 1 X Slope (%)	1.4	N/A	Storm Grate/Utility Hazard?	N/A
			N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
			N/A	Any Obstructions?	N/A			N/A
				Obstruction Type		Yes	Surface Condition? (G/P)	Good
						N/A	Curb Slope (%)	16.6
Surveyor Notes:								
N/A								
PROW/ADA:								
R304.2.2								
Total Cost:		\$	1600.00					

