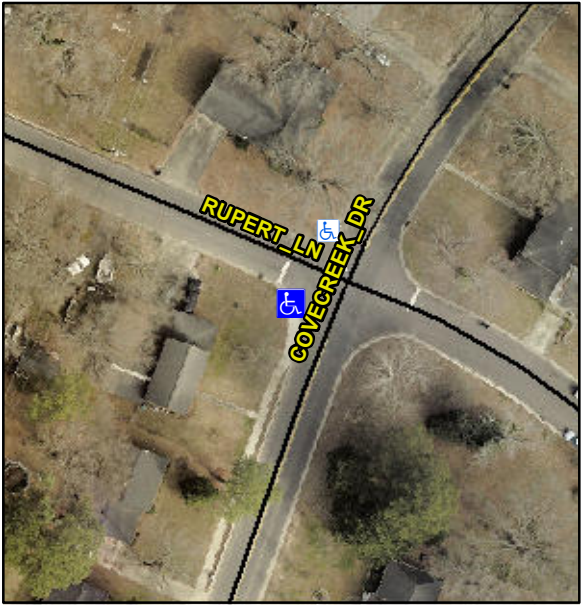


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 9382	Main Street: RUPERT_LN	Cross Street: COVECREEK_DR	Location: SW
ADA ID: C4F4D8EEDDCB	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 18.75			

	Possible Solutions:						
	Remove & Replace Entire Ramp.						
	Surveyor Notes:						
	N/A						
	PROW/ADA:						
	Not Found, R304.5.1, R304.5.3						
		Compliance	Description	Data	Compliance	Description	Data
		N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	5.8
		No	Ramp Width (in)	35.0	No	Ramp XSlope (%)	2.4
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
<p>Street 1 Name</p> <p>Stop Condition-Street 2</p> <p>Street 2 Name</p> <p>Stop Condition-Street 1</p>		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	N/A			
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	1.0	N/A	Gutter X Slope (%)	N/A
<p>Total Cost:</p> <p>\$ 1850.00</p>		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
			X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	3.5		X Walk 2 Slope (%)	N/A
			X Walk 1 X Slope (%)	0.6		X Walk 2 X Slope (%)	N/A
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	N/A	N/A	Clear Space?	N/A
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			Obstruction Type			Storm Grate/Utility Type	
<p>Yes</p>		N/A			N/A		N/A
		Yes	Surface Condition? (G/P)		Good		

