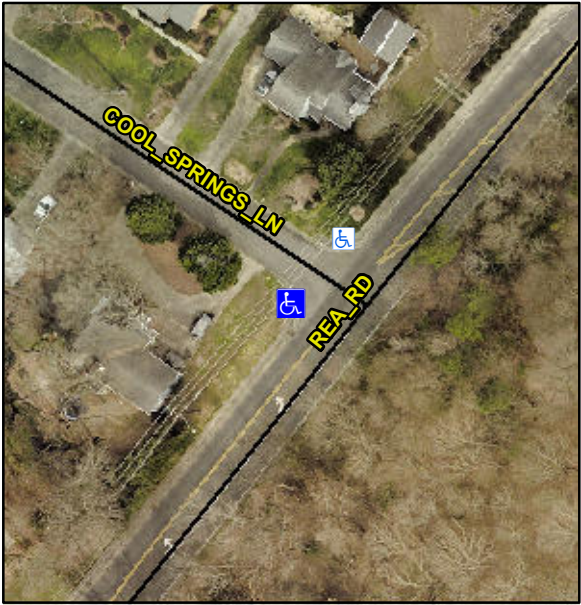


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 23702	Main Street: COOL_SPRINGS_LN	Cross Street: REA_RD	Location:	W
ADA ID: C5D140C3122F	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 12.5

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		No	Ramp Length (in)	48.0
			Yes	Ramp Width (in)	48.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.2.2</p>			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
<p>Total Cost:</p> <p>\$ 3200.00</p>			No	Painted X Walk1?	No
			N/A	X Walk 1 Direction	To SE
			N/A	X Walk 1 Width (in)	N/A
			N/A	X Walk 1 Slope (%)	0.7
			N/A	X Walk 1 X Slope (%)	1.4
			N/A	Ramp inside XWalk1?	N/A
			N/A	Road Slope (%)	0.7
			N/A	Road X Slope (%)	0.9
			N/A	Any Obstructions?	N/A
			N/A	Obstruction Type	N/A
			N/A	X Walk 2 Direction	To NE
			N/A	X Walk 2 Width (in)	N/A
			N/A	X Walk 2 Slope (%)	1.3
			N/A	X Walk 2 X Slope (%)	1.4
			N/A	Ramp inside XWalk2?	N/A
			N/A	Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
			N/A	Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good

