

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10025452	Main Street: E_INDEPENDENCE_BV	Cross Street: N/A	Location: SW
ADA ID: C72DFA03E769	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

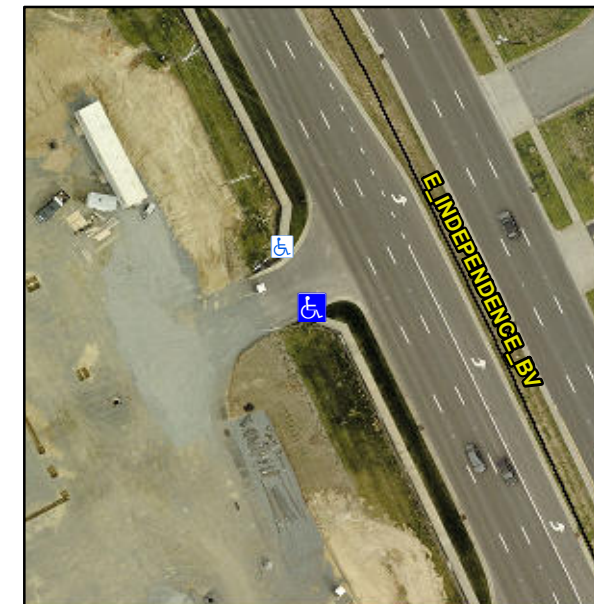

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R305.2

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	45.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	61.0	No	Grade Break Slope (%)	13.7
Yes	Ramp Slope (%)	4.5	Yes	Grade Break XSlope (%)	0.1
Yes	Ramp XSlope (%)	1.5			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	62.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	59.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.0	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.4	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset LT (in)	2.5
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	6.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.1
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.4
N/A	Painted X Walk1?	No		Road Slope (%)	3.6
	X Walk 1 Direction	To NW		Road X Slope (%)	1.6
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	3.6	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	1.6	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	14.3

Total Cost: \$ 1600.00

Street 1 Name	ENTRANCE
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

