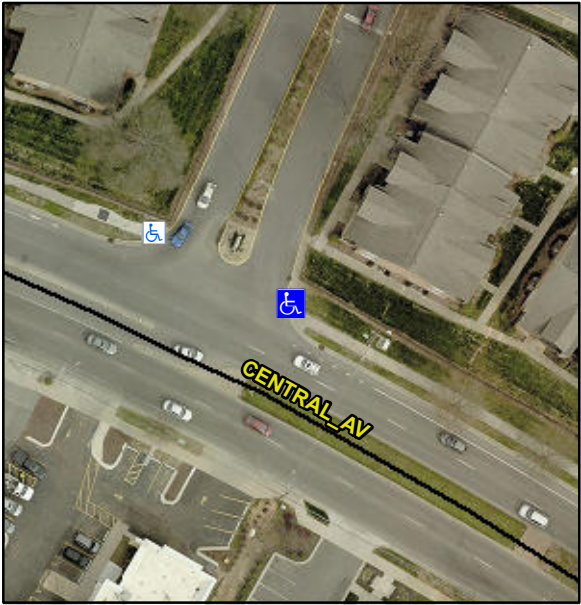


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10017106	Main Street: CENTRAL_AV	Cross Street: N/A	Location: NE
ADA ID: C77A782D6755	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>		N/A	Ramp Length LT (in)	57.0
			Yes	Ramp Width LT (in)	72.0
			Yes	Ramp Slope LT (%)	5.3
			Yes	Ramp XSlope LT (%)	1.4
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
<p>Surveyor Notes:</p> <p><b>MEDIAN ACROSS CENTRAL AV</b></p> <p>PROW/ADA:</p> <p><b>R304.3.2, R304.5.3</b></p>			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To NW
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	2.7
				X Walk 1 X Slope (%)	1.0
			N/A	Ramp inside XWalk1?	N/A
				Road Slope (%)	1.8
				Road X Slope (%)	0.3
			N/A	Any Obstructions?	N/A
				Obstruction Type	
Total Cost:		\$ 3200.00			
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	11.0

