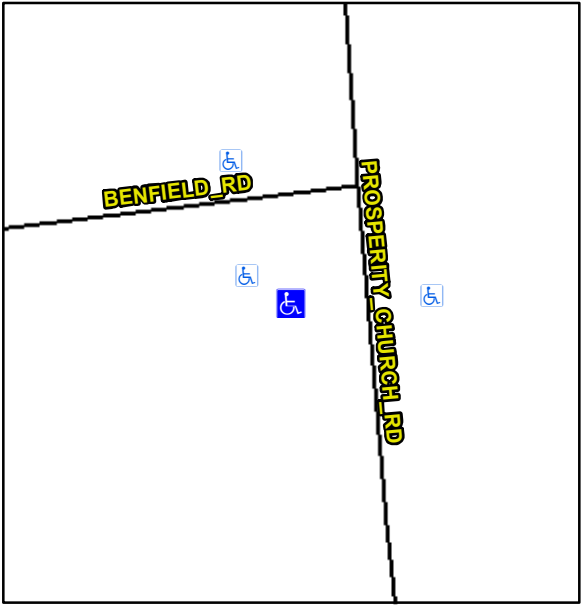


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 51615	Main Street: BENFIELD_RD	Cross Street: PROSPERITY_CHURCH_RD	Location: SW
ADA ID: C77CB1B1E4F7	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0.25	

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
	Possible Solutions:	Compliance	Description	Data	Compliance
	Remove & Replace Entire Ramp.	N/A	Ramp Length (in)	113.0	N/A
		Yes	Ramp Width (in)	68.0	N/A
<p>Surveyor Notes:</p> <p>N/A</p>		Yes	Ramp Slope (%)	2.6	N/A
		Yes	Ramp XSlope (%)	3.3	
		Yes	Flare Type LT	N/A	Yes
<p>PROW/ADA:</p> <p>Not Found, R304.2.2-Perp, R304.3.2-Para, R305.2</p>		N/A	Flare Slope LT (%)	N/A	N/A
		N/A	Flare Traversable LT?	No	N/A
		Yes	Landing Length (in)	48.0	Yes
<p>Total Cost:</p> <p>\$ 1600.00</p>		Yes	Landing Width (in)	72.0	Yes
		No	Landing Slope (%)	4.7	Yes
		Yes	Landing X Slope (%)	1.2	Yes
<p>Street 1 Name</p> <p>PROSPERITY CHURCH RD</p>		N/A	Landing Curb? (Y/N)	No	Yes
		N/A	Shared Landing?	No	No
		Yes	Gutter Ponding?	No	Yes
<p>Stop Condition-Street 1</p> <p>Signal</p>		Yes	Gutter Lip Ht (in)	0.0	Yes
		N/A	Painted X Walk1?	Yes	
		N/A	X Walk 1 Direction	To E	
<p>Street 2 Name</p> <p>N/A</p>		Yes	X Walk 1 Width (in)	106.0	
		Yes	X Walk 1 Slope (%)	4.3	N/A
		Yes	X Walk 1 X Slope (%)	3.3	Yes
<p>Stop Condition-Street 2</p> <p>N/A</p>		Yes	Ramp inside XWalk1?	Yes	
		Yes	Any Obstructions?	No	
			Obstruction Type		
		Yes	Surface Condition? (G/P)	Good	
		N/A	Curb Slope (%)	19.3	

