


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 49893	Main Street: ROCKY_FORD_CLUB_RD	Cross Street: RIDGEVIEW_COMMONS_DR	Location: E
ADA ID: C780006CC881	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 7.5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

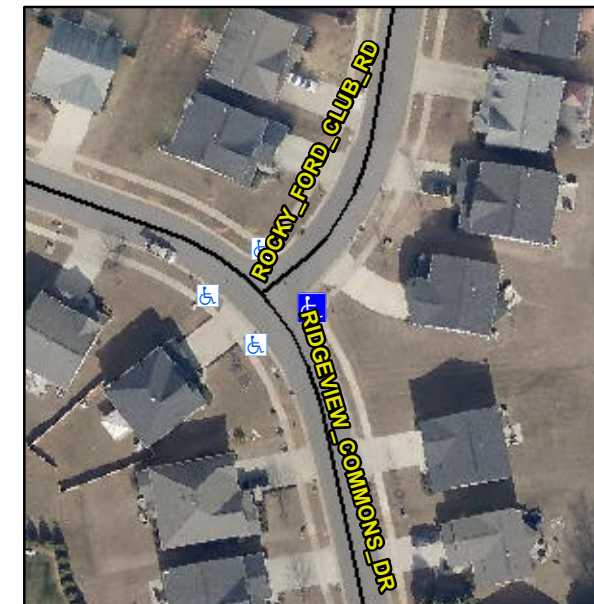

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.1, R302.7.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	66.5	Yes	Ramp Slope (%)	5.8
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.7
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	6.5	Yes	Flare Slope RT (%)	2.1
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	37.5	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.5	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	1.0	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.5
N/A	Shared Landing?	Yes			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.1
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	0.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.2		X Walk 2 Slope (%)	2.0
	X Walk 1 X Slope (%)	1.0		X Walk 2 X Slope (%)	1.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.2	N/A	Clear Space?	Yes
	Road X Slope (%)	4.5	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name **ROCKY FORD CLUB RD**
 Stop Condition-Street 2 **StopSign**
 Street 2 Name **RIDGEVIEW COMMONS DR**
 Stop Condition-Street 1 **None**

