


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 7100	Main Street: MOTORSPORTS_LN	Cross Street: STATESVILLE_RD	Location: SW
ADA ID: C7C0C3936E15	Ramp Type: Para	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

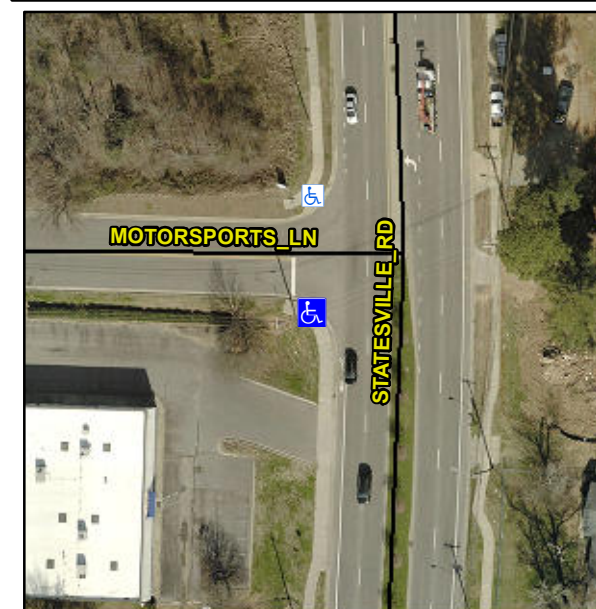

Possible Solutions:

Remove & Replace Entire Ramp.
Remove & Replace Gutter.

Surveyor Notes:

NO RT SW, RT RP < 5%

PROW/ADA:

R304.5.3, R305.2, R302.7, R304.5.4

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	47.0	N/A	Ramp Length RT (in)	50.0
Yes	Ramp Width LT (in)	84.0	Yes	Ramp Width RT (in)	84.0
Yes	Ramp Slope LT (%)	7.9	Yes	Ramp Slope RT (%)	0.3
Yes	Ramp XSlope LT (%)	1.7	Yes	Ramp XSlope RT (%)	0.4
Yes	Landing Length (in)	85.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.2	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	3.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	6.7
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	3.6
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.7		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.3		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Compliant	Curb Slope (%)	3.8

