


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 30087	Main Street: DEVONBRIDGE_LN	Cross Street: DEVONHILL_LN	Location: NW
ADA ID: C7F2B1BE6FB5	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No Severity Score: 15.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.		N/A	Ramp Length (in)	35.0	Yes	Ramp Slope (%)	5.7
			Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	4.8
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	2.5	N/A	Flare Slope RT (%)	10.1
			N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
	Surveyor Notes:		Yes	Landing Length (in)	88.0	Yes	DWS Provided?	Yes
			Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
			Yes	Landing Slope (%)	0.8	Yes	DWS Length (in)	24.0
			No	Landing X Slope (%)	7.1	Yes	DWS Full Width?	Yes
N/A			Landing Curb? (Y/N)	No	No	DWS Offset (in)	8.0	
PROW/ADA: Not Found, R304.5.3, R305.2, R302.7, R302.7.2		N/A	Shared Landing?	No				
		No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	2.2	
		No	Gutter Lip Ht (in)	1.0	No	Gutter X Slope (%)	3.4	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
			X Walk 1 Direction	To S		X Walk 2 Direction	To E	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	2.7		X Walk 2 Slope (%)	7.3	
			X Walk 1 X Slope (%)	7.0		X Walk 2 X Slope (%)	0.7	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	5.4	N/A	Clear Space?	Yes	
Total Cost: \$ 3950.00			Road X Slope (%)	6.4	N/A	Clear Space to XWalk (in)	N/A	
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
			Obstruction Type			Storm Grate/Utility Type		
				N/A			N/A	
					Yes	Surface Condition? (G/P)	Good	

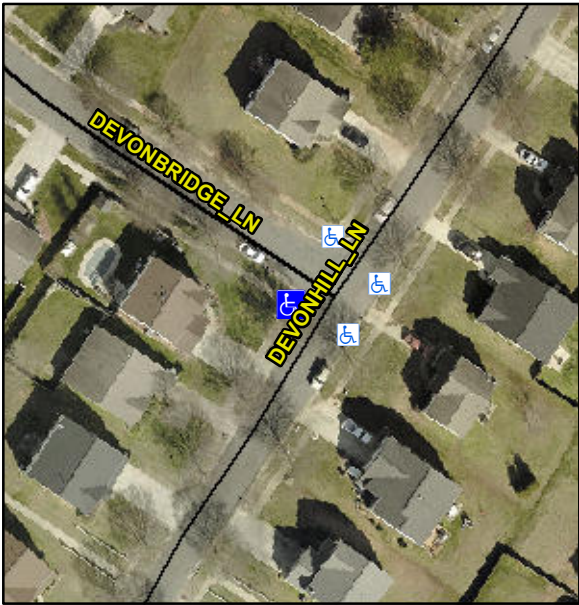