

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 11001	Main Street: SLAGLE_DR	Cross Street: TIPPERARY_PL	Location: W
ADA ID: C80E251D35BA	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 26.25

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

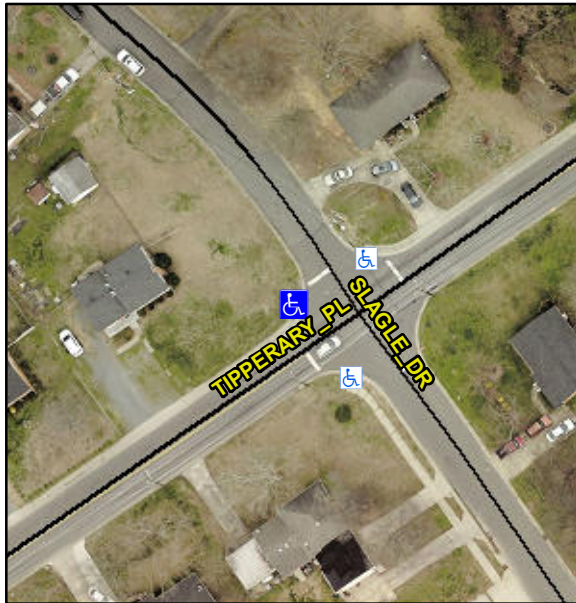

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**NO RT RP, RT RP < 5%**

PROW/ADA:

**R304.3.2, R304.5.3**

Street 1 Name	<b>TIPPERARY PL</b>
Stop Condition-Street 1	<b>StopSign</b>
Street 2 Name	<b>SLAGLE DR</b>
Stop Condition-Street 2	<b>StopSign</b>

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	26.0	N/A	Ramp Length RT (in)	28.0
Yes	Ramp Width LT (in)	48.0	Yes	Ramp Width RT (in)	48.0
No	Ramp Slope LT (%)	15.3	Yes	Ramp Slope RT (%)	1.1
No	Ramp XSlope LT (%)	2.4	No	Ramp XSlope RT (%)	2.7
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.0		X Walk 2 Slope (%)	4.6
	X Walk 1 X Slope (%)	5.6		X Walk 2 X Slope (%)	1.7
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	6.4	N/A	Clear Space?	N/A
	Road X Slope (%)	1.0	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	2.4

