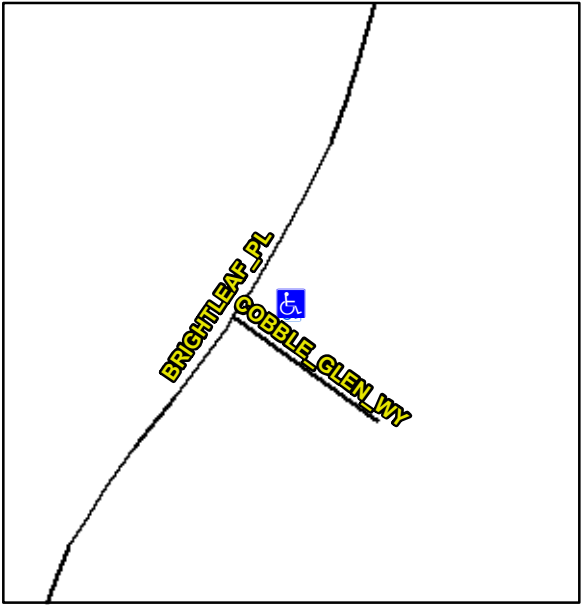


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 3923	Main Street: BRIGHTLEAF_PL	Cross Street: COBBLE_GLEN_WY	Location:	E
ADA ID: C816534ADC94	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 8.75

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
 <p>Street 1 Name COBBLE GLEN WY</p> <p>Stop Condition-Street 1 StopSign</p> <p>Street 2 Name N/A</p> <p>Stop Condition-Street 2 N/A</p>	Possible Solutions:	Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.	N/A	Ramp Length (in)	82.5	N/A	Grade Break?	N/A
		No	Ramp Width (in)	46.5	N/A	Grade Break Slope (%)	0.0
		Yes	Ramp Slope (%)	4.2	N/A	Grade Break XSlope (%)	0.0
		Yes	Ramp XSlope (%)	0.2			
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
	Surveyor Notes:	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
	N/A	N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
	PROW/ADA:	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
	R304.5.1	N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
		N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No		Road Slope (%)	N/A
			X Walk 1 Direction	To SW		Road X Slope (%)	N/A
			X Walk 1 Width (in)	N/A		Clear Space?	N/A
			X Walk 1 Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			X Walk 1 X Slope (%)	N/A	N/A	Storm Grate/Utility Hazard?	N/A
		N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
		N/A	Any Obstructions?	N/A			N/A
			Obstruction Type		Yes	Surface Condition? (G/P)	Good
					N/A	Curb Slope (%)	12.5
Total Cost:		\$	1600.00				

